

Report of Survey for Repairs of Engines and Boilers.

No. 5280

No. in Reg. Book. Survey held at

Glasgow

Date, first Survey 6th January Last Survey 7th Jan'y 1881

1031 on the Machinery of the

"Colina"

(Number of Visits 2)

Tonnage, Gross 2001

Built at Glasgow

When built 1872

Ditto, Net 1297

Owners Donaldson Bros.

Port belonging to Glasgow

Diameter of Cylinder 44" x 78"

Engines made by Barclay, Curle & Co.

When made 1872

Length of Stroke 48"

Boilers made by " "

When made 1872

Pressure of Steam 11"

If Surveyed Afloat or in Dry Dock both

Classed 100 A.1.

Registered Horse Power 100

Last Survey

Port

Lloyd's M.C. 10-79

Particulars of Repairs and Examination This vessel went into Henderson Dock for annual survey.

Propeller & sea cocks examined & found in good condition.

Boilers and Superheater examined, a patch renewed in furnace of port aft boiler & extended to meet the landing. Two of the furnaces bored at sides above landing where some pitting is taking place & found them satisfactory. Some corrosion taking place in Superheater, the stays for do are considerably corroded.

The machinery generally examined & found in good condition.

General Observations, Opinion, and Recommendation:— The Engines and Boilers are now in good order, and safe working condition, and eligible to be noted in the Register Book. Lloyd's M.C. 1-81. on account of condition of boiler & Superheater recommend them to be run by one of the Society's surveyors within the next month.

Entry or Registering Fee ... £

Survey Fee ... £ 2:2

Certificate (if required) ... £

(Travelling Expenses, if any, £)

received by me, 188

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.


Committee's Minute

Tuesday February, 8th. 1881

Assigned

B. S. 1, M

GLS145-0272

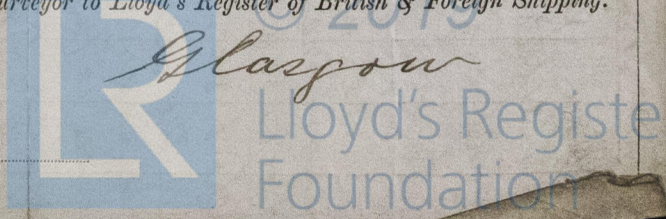

This vessel's boilers & superheaters have been examined & the vessel is therefore entitled to the record of BS 181 subject to survey within a period of 12 months.

The Surveyor however recommends the notation of Lloyd's Mb 181 although the report does not specify that all the examination necessary to entitle vessel to this notation has been made.

Submitted that he be requested to explain

MP 27.1.81

Letter 27/1/81 re do 1/2/81

per Glasgow 27/1/81
Lloyd's
Glasgow 27/1/81
Lloyd's
Glasgow 27/1/81

5280 egs.

an explanation it would be submitted that the vessel's machinery was classified Lloyd's Mb 181. It is eligible for superheaters being examined within twelve months from date instead of BS. 1.81.

MP 7/2/81



© 2019

Lloyd's Register Foundation