

# REPORT of SURVEY for REPAIRS.

No. in Reg. Book. **No.** 897 Survey held at London Date 22<sup>nd</sup> Nov<sup>r</sup> to 2<sup>nd</sup> Dec<sup>r</sup> 1865

on the Ship 'Mirage' Master H. Taylor

Tonnage 718 Built at Hartlepool When built 1853

By whom built \_\_\_\_\_ Owners Ewing & Co.

Port belonging to Liverpool Destined Voyage Bombay

If Surveyed Afloat or in Dry Dock Ratcliff Dry Dock

Last Survey, No. 26109 Port London Classed 10 A 1  
3.64.

REPAIRS Now done:-

Commenced surveying this vessel in accor-  
-dance with the first Survey Rule Section 54, with a  
view to her being continued on the A. Character. Her sides  
were brightened from the light-water-mark to the Planksheer;  
Treenails driven out from the Topsides; Limbers lifted;  
a portion of the listings cut out, as required by the Rule,  
between the Hold Beams and the Keelson.

We examined the undermentioned parts of her,  
and found the outside planking, the Treenails of the  
Topsides and the Ceiling and Clamps between decks, where  
seen, in good condition. The Limber Strakes on  
both sides, more or less defective right fore and aft;  
five consecutive floors aft near the Mizzen Mast,  
P.T.O.

Present Condition of the

Decks	Treenails	Windlass and Capstan
Waterways	Breasthooks and Stemson	Pumps
Comings	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame at the openings	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Ditto Ditto at other places	Condition, how ascertained
Planksheers	Keelsons	Sails
Sheerstrakes	Clamps and Shelves	Anchors No. of
Topsides	Ceiling	Cables
Wales	Rudder	Hawsers and Warps
Plank (Bottom) and Counter	Copper When put on	Standing & Running Rigging

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways.

Her Character would expire at the end  
of this year; but, in consequence of the defective  
Floors and Limbers, as enumerated. We beg  
respectfully to recommend that, her Class be sus-  
-pended forthwith.

The Amount of Fee.....£ : : is received by me,

Special..... : :


Certificate (if required) : :

Committee's Minute 8<sup>th</sup> December 1865

Character assigned Expense Character

Notice to owners

ditto 8/12/65

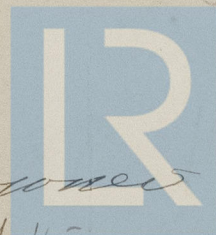

© 2021

Lloyd's Register  
Foundation

LON 650-0217



27137 Son

Mast, and two Timbers on the Starboard Bow, exposed by the listing, - very defective; - observing that, at this time there was a considerable quantity of Ballast in the Hold, right fore and aft, ranging from the Lumber Shake, to the upper turn of Bilge, on each side, which prevented our making a thorough examination of the Hold..

Wrote to the Owners, on the 30<sup>th</sup> ultimo, and "respectfully recommended as highly desirable that, the "defective Floors, &c, be renewed, and the Vessel in all "other respects made good and efficient before she "is reported to the Committee to retain her Class in "the Register Book."

The Owners subsequently informed us that, it was impossible to carry out our recommendations, at present, as they were "too much pressed for "time by the terms of the outward charter-party."

Williamson.

W. G. Jones.



© 2021

Lloyd's Register  
Foundation