


Viva

Cilo 5097.

It is submitted that before this case receives consideration the Surveyors should be requested to amend their figure for the area of each set of safety valves. The Rules would require each set of valves to have an area not less than 9460 mm^2 .

It is concluded that the longitudinal seams are treble riveted as shown in the plan & not double riveted as stated in the report, but this should be confirmed.

They should also be requested to amend their figure of 280 mm for the min. length breadth of the crank webs. From the plan this would appear to be about 530 mm. The sketch shows the dimension required.

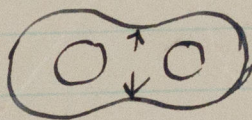

Lr 20/5



© 2019

19/5/38.

Lloyd's Register
Foundation

W267-0017

Mr Stephenson



© 2019

Lloyd's Register
Foundation