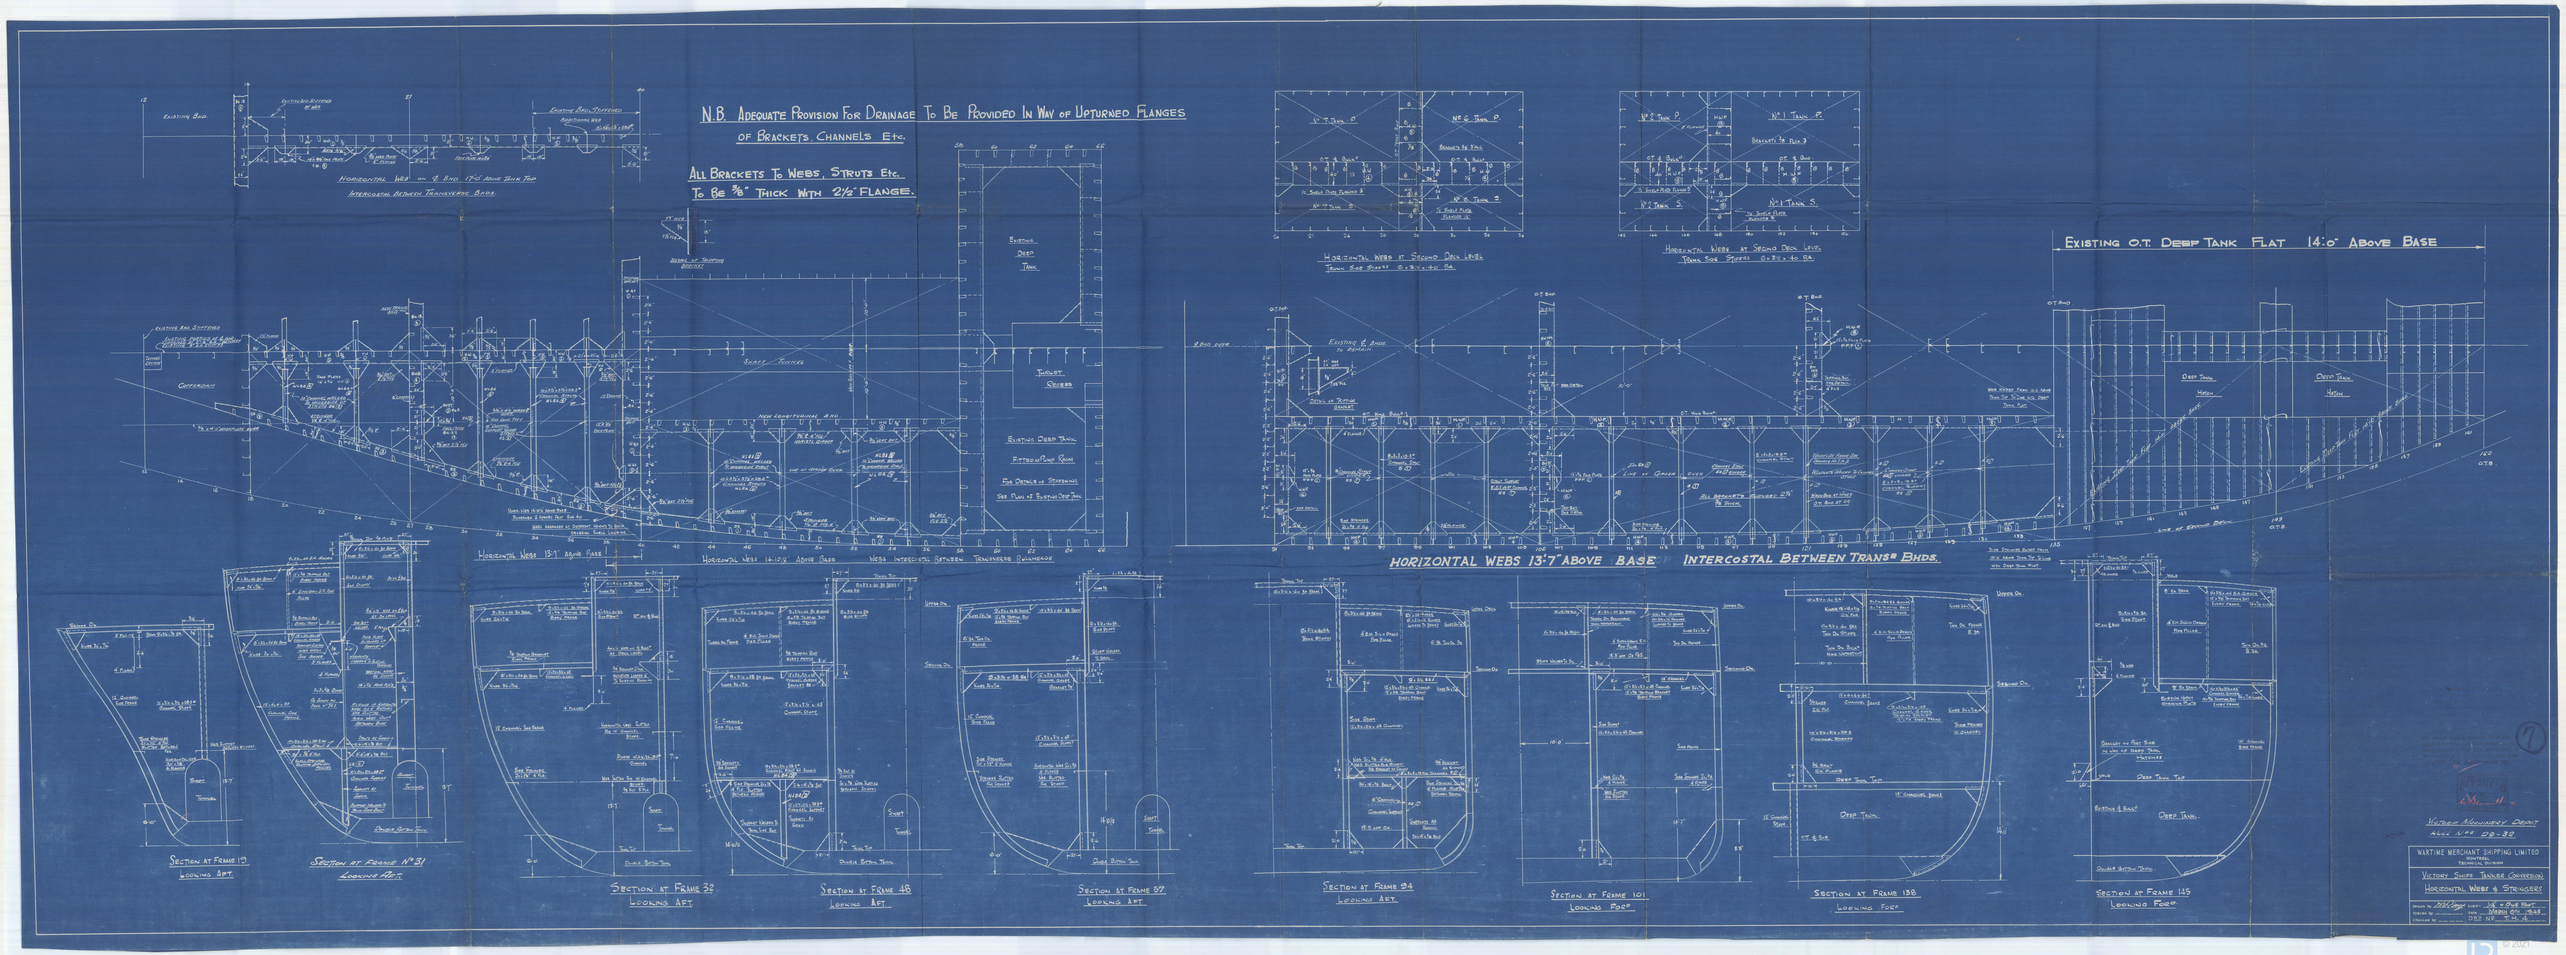
N.B. Adequate Provision For Drainage To Be Provided In Way of Upturned Flanges of Brackets, Channels Etc.
All Brackets To Webs, Struts Etc. To Be 3/8" Thick With 2½" Flange.
Horizontal Webs at Second Deck Level
Horizontal Webs at Second Deck Level
Existing O.T. Deep Tank Flat 14'-0" Above Base
Horizontal Webs 13'-7" Above Base
Horizontal Webs 13'-7" Above Base Intercostal Between Transverse Bhds.
Horizontal Webs 14'-10½" Above Base
Webs Intercostal Between Transverse Bulkhead
Existing Deep Tank
Thrust Recess
Existing Deep Tank Fitted as Pump Room
Section at Frame 19 Looking Aft
Section at Frame No. 31 Looking Aft
Section at Frame 32 Looking Aft
Section at Frame 48 Looking Aft
Section at Frame 87 Looking Aft
Section at Frame 94 Looking Aft
Section at Frame 101 Looking Ford
Section at Frame 138 Looking Ford
Section at Frame 145 Looking Ford
Victory Machinery Depot
Wartime Merchant Shipping Limited
Victory Ships Tanker Conversion
Horizontal Webs & Stringers
Drawn by
Scale
Date
Checked by
Dwg No. T.M.4