

## LLOYD'S REGISTER OF SHIPPING

UNITED WITH THE BRITISH CORPORATION REGISTER

116 SEP 1957

## ALTERATIONS TO CONDITIONS OF ASSIGNMENT OF LOADLINES

Ship's Name "FULHAM"

Official No. 164572.

Port of Registry LONDON.

This ship has been under survey at South Shields.


Between the

~~xxx~~ 15th August and 2nd September, 1957 and the following alterations to the conditions of assignment of loadlines have now been effected/found:—

At some previous time the access hatch to Lazarette on port side of Raised quarter deck aft has had the steel watertight hatch cover dispensed with and is now provided with wood hatch covers 2½" thick, 2 tarpaulins, cleats battens and wedges, in accordance with rule requirements.

At this time the two ventilators on the upper deck forward 2 @ 15" Diam., x .36", one with coaming 36" above deck and one with coaming 46" above deck connected to house to No.1 Hold also 1 @ 15" Diam., x .36" with coaming 30" above the Raised quarter deck port side at forward end to No.2 Hold, have had the closing appliances amended and are now provided with portable steel watertight covers, thickness .35" and provided with two toggle fastenings per ventilator.

The ventilator stated on the original C.11 report 1 @ 15" diam., x .36" with coaming 30" above the raised quarter deck at the after end to No.2 Hold has at some previous time been dispensed with and the opening plated over.

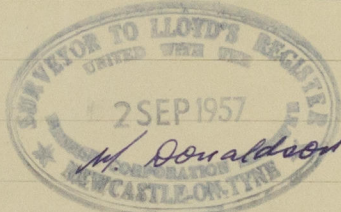

M. DONALDSON.

A copy of this Report has been placed on board.