

22 AUG 1961

4E

Received by Chief Engineer Surveyor.....

Received from Chief Engineer Surveyor.....

SHIP'S NAME "LOYOLA" REPORT Val. No. 1247

CLASS IS SUBJECT TO:

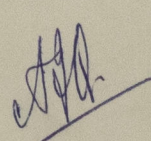
1. Exhaust gas boiler not to be used until surveyed.
2. Both Main Engine jacket fresh water coolers being specially examined by 4.62.
3. Main Engine No. 6 unit column head flange being examined on starboard side in way of crack and dealt with by 7.61.
4. Independent bilge pump water end being renewed by 10.61.

CS Advanced.

SRL Items The Surveyor states that the Main Engine No. 6 column repair as stated on Cadiz Interim Certificate should be No. 4 column. Main Engine No. 4 column repair now examined and found to remain efficient, but the Surveyor recommends that it be again examined in 6 months time (February 1962).

SRL Item No. 2 Independent bilge pump water end now replaced by new water end and on completion pump tested out and found satisfactory and it is submitted that this item be deleted from SR list.

IT IS SUBMITTED that this vessel is eligible to remain as classed, subject as above, but amended as stated in this report regarding Main Engine No. 4 unit column and without special condition regarding independent bilge pump water end.


21.8.61

© 2020

Lloyd's Register
Foundation