

93 MAR 1946

Manchester Report No. 12461.

Rpt. C. 11 (Contd.)

Index No. _____

Lloyd's Register of Shipping.

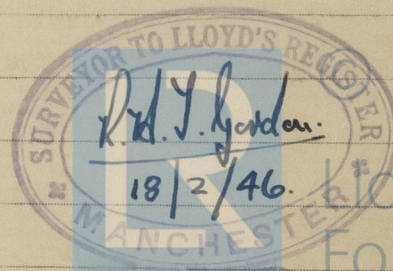
Ship's Name **M.V. "MYRTLEBANK"**Official No. **148885.**

Memorandum of alterations reported since ship was surveyed for assignment of Load Lines
in _____

OPENING SHELTER DECK.

- (1) The tonnage opening in the shelter deck has now been restored and fitted with efficient temporary covers, and the openings in the tonnage well bulkheads have been fitted with stormboards in riveted channels. ✓
- (2) The shelter 'tween decks are now drained overboard, all scuppers being fitted with storm valves at ship's sides. ✓
- (3) Five inch overboard scuppers with screw down non return valves controlled from the shelter deck, have been fitted in tonnage well (P&S). ✓
- (4) The covers, supports, bearing surfaces, tarpaulins, battening arrangements of the second deck hatchways have been placed in order. ✓
- (5) The loadlines assigned to the vessel as an open shelter decker have been verified, cut in and painted, and the old markings stamped out.

Copy of above placed on board.

202
Lloyd's Register
Foundation

003937-003947-0070

NEWPORT, MON.