

1910.43.

1

Lithgows Ltd., Port Glasgow.

Yard No. 997.

Munillo

EX

Tacoma Star

Sent to Chief Surveyors.....

Received from Chief Surveyors.....

VESSEL'S NAME s.s. "EMPIRE TALISMAN" REPORT Grk. No. 22733

For the CHIEF SHIP SURVEYOR and CHIEF ENGINEER SURVEYOR.

In cases which have to be submitted to the Classing Committee "the endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case so that the Classing Committee may have all the salient points presented in the endorsement."—(Extract from Sub-Committee's Report, 24/5/92.)

ature of Survey First Entry

When due

This vessel is of the Y 7 type. The scantlings are suitable for a draught of 18" in excess of that corresponding to the freeboard which could be assigned as a C.S.S. vessel. (See endorsement 18.7.44 attached).

The tank top plating has been increased in thickness under the hatchways in lieu of ceiling.

It is stated that holds and 'tween decks except Nos. 1 & 5 will be fitted with insulation at a North American port.

Minor fire damage to upper deck plating, girder, beams etc. in way of No. 4 'tween decks has been dealt with.

LOCAL "With freeboard"

2 Dks

Cell DB 314' 1216t, tank in way of tunnel 410t, FPTs 202t, APT 115t
FK, 8BH (Coll to W dk, 7 to 2nd dk) 6 divisional W.T. BHs in 'tween
decks, pt. Cem., Lloyd's A & CP
F 39'



O.L. 447.8'

E.S.D.

a. The class is assigned and maintained upon the understanding that the equipment will be made to accord with the requirements of the Rules when the present state of emergency has passed, and that cargo battens in uninsulated cargo spaces will be fitted at the first available opportunity.

Insert in S.R.L:- (A bower anchor and 45 fathoms of chain cable to be supplied).
Cargo battens in uninsulated cargo spaces to be fitted at the first opportunity.

The Surveyors should be requested to furnish the riveting particulars for the forecastle side plate, which have been omitted from their report.

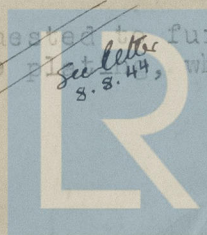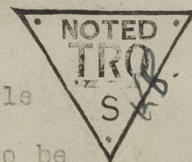

Lloyd's Register
Foundation
1.7.44.

004527-004533-0005