

Gross Tonnage 7128.16

Depth to 2nd Deck - 28.58' of beam at side of uppermost continuous deck. See Sec 3 (1c)

N/M BEATUS

Victoria Machinery Depot Co.Ltd., Victoria B.C.

Yard No.24

5c,7,42

N/M STANLAND.*

F.E. (FBD)

Received by Chief Ship Surveyor.....

Received from Chief Ship Surveyor.....

VESSEL'S NAME s.s.s. "FORT TREMBLANT" REPORT Ver. No. 5850

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

D to W dk 37.33' D to 2nd dk 28.58' D for scantlings 36.58' (i.e. 8' above 2nd dk)

1st Long No. 15217 Depth "d" -
2nd Long No. 38879 Proportions = L/D 11.14
Framing As approved Sheerstrake As approved

This is a sister vessel to the "FORT ST.JAMES" etc.

The scantlings are suitable for a draught of 18 1/2" in excess of that corresponding to the freeboard which could be assigned as a C.S.S. vessel.

This vessel appears to have been built in accordance with the Rules and the approved plans, and it is submitted she is eligible to be classed 100A "With freeboard" X SEE SPECIAL CORRESPONDENCE ETC.RE ANCHORS X

The Summer Freeboard as shown on the attached extract from the Freeboard Verification Form, now marked on the vessel's sides, to be inserted in the classification certificate and recorded in the Register Book, and further, the remaining freeboards, as shown on the accompanying extract, to be inserted in the certificate of classification.


2 Dks "Butts of shell and deck plating electrically welded".
Coll DB 368' 1149t, DTa 20' 765t, FPT 145t, APT 160t
Bc, 7BH (Coll to W dk, 6 to 2nd dk) 6 divisional W.T. BHs in 'tween dks.,pt.sem. and 441.5'

S.S.D.

The class is assigned and maintained upon the understanding that the equipment will be made and the two bower anchors and stream anchor on board submitted to the Statutory Test to accord with the requirements of the Rules when the present state of emergency has passed.

Insert in S.R.L:- (A bower anchor and 45 fathoms of chain cable to be supplied and two bower anchors and stream anchor on board to be submitted to Statutory Test).

NOTE: See correspondence attached to First Entry Report on "FORT ST.JAMES" re discrepancies in scantlings.

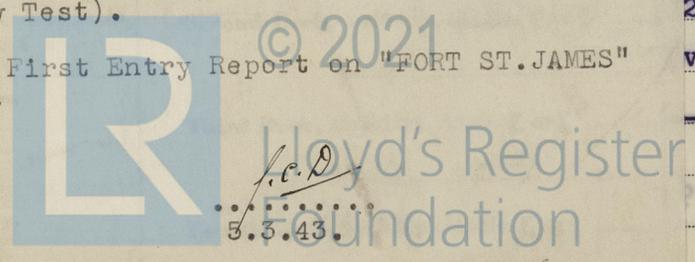

004564-004572-0115