

EA

22 MAR 1965

Ship's name "GLOUCESTER"

Port

a) AUK
b) DDN

No.

11861
7082

Class is subject to

Last survey date

7.1.65.

NONE

S.R.L. Appendix (as before of ~~EXXON~~)

Nature of present survey (afloat ~~XXXXXXXXXXXXXX~~)

- a) Permanent/temporary repairs to leakage on account of wasted scupper pipe.
- b) Permanent repairs to H.W. damage.


Recommendation

SUBJECT to indented shell plate J.1 (p.s.f) and internals in way, to wasted bulkhead 1/2 and 2/3 in way of upper tween deck and to No.4 upper tween deck chocks being specially examined and dealt with as necessary by the Special Survey.

As Now Subject.

IN S.R.L.APPENDIX

Shell seam of 'J' & 'K' strakes in way of frs.109/111 (p.s.f) indented.
(Sternframe at top gudgeon E.W. 7,61).
Indents in shell plating (p & s).

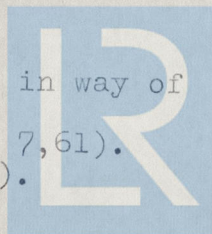

© 2020

Lloyd's Register
Foundation

4-3-66
X