

14 MAY 1941

## Lloyd's Register of Shipping.

Vol. 526

Ship's Name

STUART PRINCE

Official No.

168022


Memorandum of alterations reported since ship was surveyed for assignment of Load Lines in accordance with Circular 1777, dated 1<sup>st</sup> April 1941 for

Alterations for the revision of the load lines of open shellin decked ships

Hatch over the tonnage well plated over and made watertight with .35 steel plate welded all round to the hull angle framing and stiffened with 4" x 3" x .40 angles. In this plate three watertight steel hatches fitted (2'-3" x 2'-3"), with hinged steel covers secured by Toggles.

The scupper openings in the well deck and shell plating closed watertight with welded spigoted patches.

The watertight bulkheads extended watertight to the shellin deck by welding the existing tonnage opening closing plates of the tween deck bulkheads to the bulkhead plating, and the hook bolts made watertight and secured by welding.

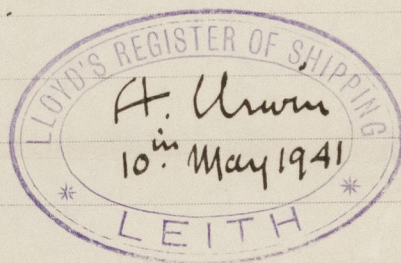

Noted *RB*.

14 MAY 1941

*Handwritten notes:*  
Total 145  
No alterations  
in records  
added double  
not suitable  
to W.E. case  
B. inclusion as RB  
Bills in shellin  
deck

*Handwritten:*  
8 Feb 3-5  
on 1941 8



© 2020

Lloyd's Register  
Foundation