

Report of Survey on Refrigerating Machinery & Appliances before loading.

(Received at London Office)

Date of writing Report 30th Nov., 1938 When handed in at Local Office

Port of SHANGHAI

Survey held at SHANGHAI

Date: First Survey and Last Survey Nov. 28 1938
(No. of Visits one)

Refrigerating Machinery and Appliances of the Twin Screw Steamer "HAKOZAKI MARU"

Vessel built at Nagasaki
Owners Nippon Yusen K.K.By whom Mitsubishi Zosen Kaisha When 1922 6
Port Tokyo Voyage

Survey No. 69047 Port

PARTICULARS AS ENTERED IN REGISTER BOOK.

REFRIGERATING MACHINES.				System of (1) Refrigerating (2) Insulating the Chambers.	POWER.		INSULATED CARGO CHAMBERS.		Notation and Date of Last Complete Periodical Survey.
No. of Compressors.	System.	Makers.	Date of Construction.		Cubic feet of air delivered per hour.	Ice melting capacity per 24 hours. Tons.	No.	Capacity. Cubic ft.	
2	Carb. Anhy.	J. & E. Hall, Ltd.	1922	Brine SlabCork	-	12	3	8,240	Lloyd's RMC 11-38

Particulars of Examination and Repairs for Loading Port Survey.

Insulation been examined throughout and found to be clean and in good order at this time	Yes	Have the test holes been efficiently closed	Yes
Insulation been tested for fullness and dryness	Yes		
Insulation was not examined now for condition, where was this requirement carried out	-	By whom was it issued	-
Certificate produced for that examination	-	Have the snow boxes and air trunkways and fastenings been examined	Yes
Watertight doors been examined and worked	-	On the snow box, refrigerator & cargo chambers	Yes
Machinery and auxiliaries been examined and tested under working conditions at this time	Yes		
Condenser and refrigerator coil terminals and connections been examined	Yes		
Brine pipes, valves and connections been examined	Yes		
Thermometer tubes with their connections and fastenings been examined	Yes		
Ent cargo battens supplied and are they in good order	Yes		

State the temperatures to which the compartments were reduced before loading.

Port Chamber	was reduced to	28° F.	was reduced to	
Centre "	"	26° F.	"	
Starboard "	"	9° F.	"	
"	"		"	

Survey is not complete, state what arrangements have been made for its completion and what remains to be done Complete.

Now Done: Examined the refrigerating machinery under working conditions, and Chambers Port, Centre & Starboard under conditions mentioned above.
All found in good condition.

General observations, opinion, and recommendation This vessel, in my opinion, is fit to carry refrigerated cargo during the contemplated voyage to Europe.

Fee £125:00 :

Fee applied for, 28th Nov., 1938.

Travelling Expenses £ 5:00 :


Received by me, 19.

FRI 13 JAN 1939

Committee's Minute
note p. Survey
Assignednote Stbd gas
Condenser coils

+ Lloyd's RMC 11.38

Surveyor to Lloyd's Register of Shipping.

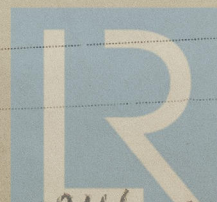

© 2021

Lloyd's Register

009116-009121-00124

See Memo 69047

27
10/1/29

THEY ARE THE ONLY ONE

• THE ONLY ONE WHOSE POSITION IS NOT CHANGING

• THE ONLY ONE WHOSE POSITION IS NOT CHANGING

CO:0310X
CA:0 7X

• THE ONLY ONE WHOSE POSITION IS NOT CHANGING

• THE ONLY ONE WHOSE POSITION IS NOT CHANGING
• THE ONLY ONE WHOSE POSITION IS NOT CHANGING

• THE ONLY ONE WHOSE POSITION IS NOT CHANGING
• THE ONLY ONE WHOSE POSITION IS NOT CHANGING

THE ONLY ONE WHOSE POSITION IS NOT CHANGING

THE ONLY ONE WHOSE POSITION IS NOT CHANGING

THE ONLY ONE WHOSE POSITION IS NOT CHANGING

THE ONLY ONE WHOSE POSITION IS NOT CHANGING



© 2021
Lloyd's Register
Foundation