

21 APR 1949

Chief Ship Surveyor

Received from Chief Ship Surveyor

GB
SHIP NAME "MARKAB" REPORT Ant. No. 25236

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

For conditions of class see previous endorsement.

The ANTWERP Surveyors report the vessel placed in dry dock, and the requirements of a PERIODICAL SPECIAL SURVEY (A), due 2.49, complied with at this time.

In consequence of heavy weather damage previously reported, repairs effected to shell plating etc.

Repairs effected to stem bar, to indented bow plating and to shell rivets in No.2. hold, as above.

The indented shell plates, etc. (p & s) ^{as above} specially examined and found efficient. The Surveyors now recommend this item be transferred to endorsements of class (Group B).

Sternframe at oxtter, as above, specially examined and found further fractured. The welding of upper edge of boss plates, to shell also found fractured. These have now been dealt with as shown on sketches.

The Surveyors however recommend these items be specially examined at the next dry docking.

The sternplate, as above, specially examined and found efficient.


The Surveyors recommend no further note be made of this item.

The forward deep tanks, as above, have now been dispensed with, and additional transverse framing fitted as per attached drawing.

IT IS SUBMITTED the vessel is eligible to remain as classed, with record of docking survey 3.49, and Notation of "S.S. Ant-3.49" as recommended, subject to sternframe in way of oxtter (E.W.-10.47 & 3.49), also boss plates (p & s) (E.W. 3.49) being specially examined at next dry docking, also to (a bower anchor and 45 fathoms of chain cable to supply), but without other condition.

P.T.O.

010445-010501-0323 1/2

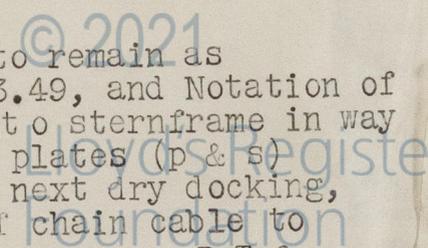

"M A R K A B"

3.49 Ant.) Subject
S.S. Ant.-3.49) Without.

ENDORSEMENT OF CLASS (Group B).

Indents in side shell plating (p & s).

Jmb
21.4.49
BAM

Delete from R.B. ✓

fwd 285t. ✓

O.S.S. Records Dept.

to note, Sternframe
Boss
Deep tanks.



© 2021

Lloyd's Register
Foundation

010495-010501-0323