

# Lloyd's Register of Shipping.

Ship's Name S. S. HOLLYBANK EX EMPIRE SOUTHERN  
AN OCEAN UNIT

Official No. 169023


Memorandum of alterations reported since ship was surveyed for assignment of Load Lines in 1942.

The accommodation for gunners at the after end of N° 5 tween deck port and starboard now removed. Eight 10" diam. side scuttles port and eight 10" diam. side scuttles starboard side removed and openings in shell closed with riveted spigot plates. One 4" diam. soil discharge and three 2½" diam. lavatory discharges port side and two 2½" diam. lavatory discharges starboard side now removed and openings closed with welded spigot plates. The opening in the bulkhead forming entrance to gunners accommodation from crew space now closed with a bolted plate cover. One 24" diam. escape scuttle on upper deck over accommodation at after end of N° 5 hatchway now removed and opening on deck closed with a welded closing plate. Two 9" diam. and four 6" diam. coil ventilators over the accommodation removed and openings on deck closed with welded spigot plates.

Alex. M. Jenkins.

Surveyor to Lloyd's Register of Shipping  
 LONDON. 2<sup>ND</sup> FEBRUARY 1946.

AK.  
 5.2.46

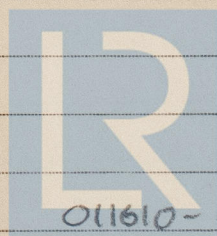

© 2021

Lloyd's Register  
 Foundation

011610 - 011618 - 0120