

4 E

22 MAY 1951

by Chief Engineer Surveyor

Received from Chief Engineer Surveyor

EL'S NAME VALETTA CITY.

REPORT

Cff. No. 57218.

The remarks of the Chief Engineer Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/52.)

of Survey ~~REPAIRS-TO-ENGINES-AND-BOILERS-DUE-TO-DAMAGE-THROUGH-~~

BS due 1,51 now held.

Several combustion chamber wrapper plates cropped and part renewed or built up where wasted. Back plates and furnaces built up where wasted, and landing cracks veed out and welded and riveting renewed as necessary. A number of screwed stays renewed. Manhole door flanges built up. Internal feed pipes renewed. Stay and plain tubes found locally wasted and the Surveyor recommends the stay and plain tubes of all boilers be renewed by 6,51.


Pending renewal of tubes the record of B.S. 4,51 to be withheld.

IT IS SUBMITTED action be deferred.

Subject.

012148-012158-0131

21.5.51.

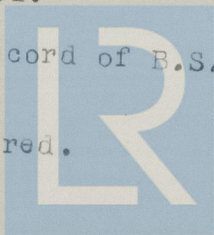

© 2021

Lloyd's Register  
Foundation

Jm