

Ship's Name ~~SS/MS~~ "CONDE DE ZUBIRIA" (L.R. 507831)

Gross tons 3256 Port of Registry Bilbao Port Bilbao

Date of build 1-1918 Is there a Rpt. 9? No Rpt. No. 14066

No. of visits 2 First date 22-10-65 Last date 25-10-65

Interim Cert. issued & copy herewith? Yes Damage rpt. issued & copy herewith? No Last rpt. (H.Q. only) BBO 14024

Date of completing rpt. 1-11-65 Surveyed at, if different from Port above -

Surveyed afloat and/or in D.D. Afloat Last date of examination in D.D. -

Has a Load Line Survey been held? No Summer freeboard as verified -

State which additional Rpt. 8 is attached: (~~Gen~~), (~~PS~~), (~~DR~~), (~~EQ~~), (~~Rig~~)

Survey fees Damage fee Expenses ---

Lo 3780 Ptas.

S.A. fee -

17 NOV 1965

I have surveyed the above-named ship in accordance with the Rules for DAMAGE STATED
Due to contact with quay at Seville on 17th October 1965.

Found: Damage situated in way of side shell plating at forecastle (SS)

Permanent Repairs Now Effected:-

Forecastle sheerstrake plate No 2 (SSF) cropped and partly renewed.
Nos. 1 and 2 plates in strake below forecastle
Sheerstrake(SS) from forward faired in place.
Forecastle deck stringer angle cropped and partly renewed (SS)
2 shell frames cropped and partly renewed, 2 shell frames faired in
place 1 beam knee renewed, 3 beam knees and 2 beam ends faired in place,
all in forecastle space (SS).

2 Sidescuttles removed, overhauled and refitted in way of shell plate repairs.

All repairs hose tested on completion and found satisfactory

The items now surveyed are detailed on this report. All were found or placed in good condition unless otherwise stated.
I recommend, therefore, that this ship remain as classed ~~with~~/without fresh record ~~of by docking~~ of Survey

(Where conditions of class are recommended to be retained, imposed, amended or deleted, particulars must be stated above and on the interim certificate.)

Sgd: James L. Troake
Surveyor to Lloyd's Register of Shipping

Date of Committee MONDAY 22 NOV 1965

Minute Cusnow

FOR CHAIRMAN
CLASSN. CTTEE


013945-013949-0072

ALSO FOR
SPL FOR
S.S.
PROS
BT.
SRL
POSTING
HEADER
CERT

action taken or recommended should be described fully under "defects & repairs". When any part has been subjected to pressure test this should be stated.

date of the next Special Survey. Where repairs have been effected or it is considered that re-examination or repairs should be made before that date the circumstances and

The condition of any item is to be described as "good" only when it has been examined, found or placed in good condition and is considered to be acceptable until the due

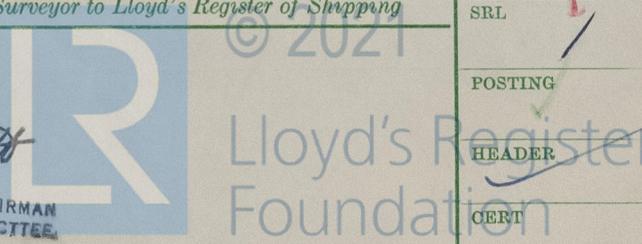

PARTICULARS OF DEFECTS, REPAIRS, ALTERATIONS, ETC. The reason for repairs must be stated and repairs on account of damage, the alleged cause of which must be given, should be detailed separately from wear and tear repairs and, besides being detailed above, should be noted in the following summary. *State what action has been taken regarding items which are subjects of class or in SRL Appendix, whether outstanding or new.* Any alterations to existing particulars in the Register Book should also be reported above.

SUMMARY OF DAMAGE REPAIRS	SHELL PLATES	FRAMES	DECK PLATES	BEAMS	OTHER ITEMS
Renewed	1 Part	2 Part	-		1 Beam Knee Stringer Angle (Part)
Removed and faired or replaced	-	-	-		
Faired or repaired in place	2	2	-	2	3 Beam Knees



© 2021

Lloyd's Register
Foundation