



Lloyd's Register of Shipping,

Ramsden Square,

Barrow-in-Furness, 28 - 12 - 27.

Dear Sir,

Reference

"E"

We enclose herewith a sketch of the proposed repair to be made on the crank shaft of the Motor Vessel "MODAVIA" (Vickers' No.626) recently constructed here.

The crank pin of No.5 engine was found to have developed a flaw, and it is proposed to cut the pin webs and journal and fit a new ones as shewn, of the same built type shrunk into the webs and further secured by two dowel pins $2\frac{1}{4}$ " diameter.

The existing web is 11.3" thick but has a shoulder in way of the journal; by merging this shoulder into the general thickness the new web will be 11.4" thick, which is the rule thickness if the shaft had been only rule diameter, viz; 18.27".

In view of the urgency of the case the Builders would be glad if they could have approval tomorrow, and we shall therefore be obliged if you will telegraph your decision.

The repairs are to be carried out at this port.

We are, Dear Sir,

Yours faithfully,


The Surveyors,

Per:-

Wm Cowie

The Secretary,

LONDON.

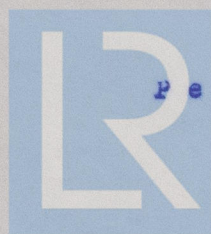

Lloyd's Register
Foundation

W106-0210

• **NOTES**

WIDE REQUESTED

29 DEC 1927

Referred to the Chief Engineer Surveyor.

27

THE UNIVERSITY OF CHICAGO

[Faint, illegible text from bleed-through]

St

1. The first step is to identify the problem or question that needs to be answered.

[Faint vertical text, likely bleed-through from the reverse side]

and of the Journal's editorial board, and the Journal's

1. What is the purpose of the study?

1955年1月1日 星期日

1952年10月10日，在天津、北京、上海、南京、杭州、武汉、广州、香港等地，同时举行了大规模的游行示威，庆祝中华人民共和国成立三周年。

§ 117 has been amended two or three times in the past, and it is

the current of the river, and the water is very shallow.

"ALIVATOR" LOANST TO STAIN KIDN AND NO OTHER

of the Department and to issue a statement explaining the

1998

© 2021

Lloyd's Register
Foundation