

1907
July

G E N O A . -

December 6th 1920 .

P. T. B R O W N

Messrs PAOLO SCHENI, on behalf of the Owners, attend aboard the s.s. "SAHALI", M# 70877 in Register Book - 5784 Tons Gross, on 30th November 1920 and subsequent dates for the purpose of ascertaining the nature and extent of damage caused to this Vessel by the s.s. "SS D'ITALIA" colliding with her in Genoa Harbour at about 11. A.M. on 27th November 1920 . .

For further particulars see Log Books and Protest . -

D A M A G E F O U N D .

Eight stanchions bent on poop..

One running stanchion broken on poop.

One stanchion in poop rail broken and several bent..

One boom guy on N° 4 starboard boom carried away . .

Top of rail forward part of after deck bent and rivets of two eye bolts forced out . .

Lower half of both davits on N° 3 lifeboat broken and screws bent . .

Davits on N° 1 lifeboat and screws bent . .

Boat checks N° 1 and 3 lifeboats torn loose from deck and damaged. N° 1 and N° 3 lifeboats badly dented . .

R E C O M M E N D .

These stanchions to be straightened . "

This stanchion be repaired..

These stanchions to be repaired.. and several bent..

This to be renewed . .

To be faired and eye bolt riveted . .

To be renewed on arrival at a Home Port . .


To be faired and made workable..

To be repaired .

To be faired and boats made watertight . .

W1574-0070

© 2020

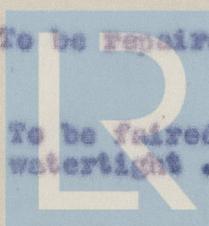

S. S. "GRANALE"

FOUND . "

RECOMMENDED . "

3 lifeboat covers badly

To be repaired . "

stanchion on navigation bridge To be fairied . "

rust around porthole in fire- Rivets to be removed . "
ports broken off . "

work fenders lost . " These to be replaced . "

we recommendations to place the vessel in the same good and
int condition as before the damage took place . "

P. J. Mac.

At. 1000,-

" 10.-

Surveyor to Lloyd's Register . "



© 2020

Lloyd's Register
Foundation

W1574-0070

2/2