

W42-0117

- 3 MAR 1942

Chief Ship Surveyor.....

Received from Chief Ship Surveyor.....

NAME HAR PALION

Lth. 20619
Rpt Lth No. 20620

Remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement.—Extract from Sub-Committee's Report, 24/5/92.)

(The 1st S.S. No, 2 due 5.40 has been partly held)

A notation of 'Examined 6.41' valid for a period of 12 months has been assigned.

The class is subject to the after E.R. bulkhead shell plating in way(p.s) being repaired and indented shell plate in D strake at forward end of bilge keel (s.s) being dealt with at the Owners' convenience.

Indented bottom and side shell plating (p.s) and buckled stem and stem plating require to be dealt with at the Owners' convenience.

The LEITH Surveyors report the vessel placed in dry dock, bottom coated, and on account of damage through port anchor cable running out, repairs effected to windlass.

The port bower ^{anchor} and 120 fathoms of chain cable are missing and 30 fathoms removed ashore for repairs (see letter),

120 fathoms of chain cable have been supplied.

The spare bower anchor has been shackled to port cable.

It is recommended a bower anchor and 30 fathoms of chain cable be supplied at the end of the present emergency.
Minor wear and tear repairs effected.

The same Surveyors later report the vessel examined as far as practicable afloat after grounding.

Soundings taken, but no evidence of leakage was found.


The Surveyors further recommend the vessel be examined in dry dock at the first opportunity.

It is submitted action be deferred.

DOCKING DATE 2.42)

Insert in S.R.L:- Dry dkg. (Grounding)

(a bower anchor + 30fms @. to supply) *Stalies*

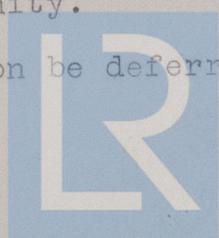

© 2020

Lloyd's Register Foundation
S.S. Partly held.

W42-0118

Hawsers & Warps.....

Standing and Running Rig.....

(which n
ok & Sup
Machin
(Including
K.L.M
S.S.
S.C.I
s }
d }
with
Pest
def
d
turn
ained
s remo
range