

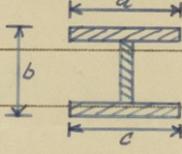
Lloyd's Register of Shipping.

Ship's Name S/S "ERIKSBORG", of Kivik. Official No. 7108.

Memorandum of alterations reported since ship was surveyed for assignment of Load Lines in _____

No.2 hatchways in bridge- and main deck have now been increased in length and the small trimming hatches at aft end have been removed.

Particulars of the hatchways now:

Description	BRIDGE DECK	MAIN DECK
	No.2	No.2
Dimensions	7920 x 4270 ✓	8530 x 4270
COAMINGS:		
Height above Deck	810	413
Thickness, Sides	11	11
" , Ends	11	11
Stiffeners	180x75x10 ✓	✓
Brackets, Stays	2 S 1 E	
HATCH BEAMS:		
Number	4	4
Spacing	1585 ✓	2130 ✓
Scantlings		1706.
	a) 150 x 17	150 x 17 ✓
	b) 275 x 10 ✓	315 x 9 ✓
	c) 150 x 17 ✓	150 x 17 ✓
Bearing Surface	90 ✓	90 ✓
HATCH COVERS:		
Material	Wood	Wood
Thickness	65 ✓	63
How fitted	F & A	F & A ✓
Bearing Surface	75 ✓	75
Spacing of Cleats	Max. 610 ✓	Max. 610 ✓
Number of Tarpaulins	2 ✓	1

Battens and wedges efficient and in good condition.

Tarpaulins in good condition and in accordance with Rule requirements.

Lashings provided in accordance with Rule requirements. ✓

Helsingborg, 15th March, 1952.

Sven Boivin

.....
Surveyor to Lloyd's Register.

Noted
MA

23 MAR 1952



© 2021

Lloyd's Register
Foundation

002085-002093-0163