

100AL LMC CS 10,57
SEE ALSO ENDORSEMENT
DATED 9.2.60.

Received from Chief Ship Surveyor 17 FEB 1960

S NAME "BELGIAN GULF" REPORT Cpn. No. 18046
VC

Standing Conditions of Class: SUBJECT to cracks in 'C' strake
in way No.6 starboard main cargo tank (fwd) and No.10
port main cargo tank (aft) and forecastle guard rails
etc., being specially examined and dealt with as necessary
by 1.60.

Appendix. (As before ~~or None~~)

Place of Present Survey: (Afloat and ~~in dry dock~~)


Examination of temporary repairs (cement) previously
effected to the above fractures; during the examination
a fracture was found in cargo tank No.10 (p.s) to which
temporary repairs had not previously been effected, and
were not effected at this time.

Recommendation:

SUBJECT to Permanent repairs being effected to fractures
in bottom shell plating in way of cargo tanks No.6 (s.s.)
and No.10 (p.s) on the ship's arrival at Antwerp to which
port she is proceeding, but further ACTION be DEFERRED
for repairs.

SUBJECT. AMENDED.

IN S.R.L. APPENDIX.
Shell plates G.4 & 5 and H.4 (s.s.)
slightly indented.

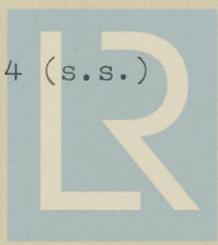

© 2020
R.M.
12.2.60

Lloyd's Register
Foundation