

Port Louis,

Mauritius.

29th September, 1959.

S.S. "DALIA"

Owners: Messrs Gundelfinger & Co.

Port of Registry: Durban.

Official Number: 150215.

Registered Tonnage: Gross - 5,162 tons.

Net - 3,199 tons.

Classification: + 100 A.1 at Lloyds.

I, the undersigned, do hereby certify, that I did, at the request of Messrs Ireland, Fraser & Co., Ltd., Lloyds Agents at Port Louis, Mauritius, survey on the 23rd, 24th and 28th days of September, 1959, the boilers of S.S. "Dalia" whilst afloat in Port Louis harbour and report as follows:

Vessel arrived in this port on the 23rd September, 1959. Chief Engineer reported that tubes were leaking heavily in the three boilers, causing a daily consumption of twenty tons of boiler water at sea.

After examination of all furnaces, the following amount of tubes and C.C. stays were attended to:

In Starboard Boiler: Forty four plain tubes expanded in the three furnaces, one plain tube renewed in starboard furnace, one stay tube lagged in centre furnace and one soot blower housing tube in centre furnace at plate lightly welded to plate. This tube had been previously caulked number of times and caulking groove was deep.

In Port Boiler: One hundred and two plain tubes expanded in three furnaces, five C.C. nuts and washers renewed in starboard furnace.

In Centre Boiler: Twenty six plain tubes expanded in the three furnaces, two C.C. stay nuts and washers renewed in starboard furnace and one C.C. stay nut and washer renewed in port furnace.

When these repairs were completed, the steam was raised in boilers and all tubes were found tight.

Four new tube stoppers made and supplied to vessel.

The trouble with leaky tubes in these boilers are probably caused by the working of tube plates. When under steam, these plates are lagged out in C. chambers.

After these repairs, I consider the vessel fit to retain her class.

Given under my hand, this 29th day of September, 1959, at Port Louis, Mauritius.


SEEN  
IRLAND FRASER & CO. LTD.

(S) H.G. ROBINSON

MANAGING DIRECTOR  
LLOYD'S AGENTS

*Fivekate*

ENGINEER & SHIP SURVEYOR  
under Art. 16 of Ord. 15 of 1916

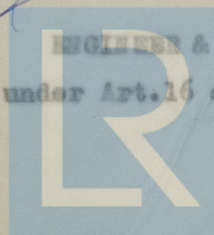

© 2020

Lloyd's Register  
Foundation

002630-002638-0133