

Lloyd's Register of Shipping.

Ship's Name *S.S. "DALIA"*Official No. *150215.**Post natal Rpt 8. No. 3330. dated 25/3/41*

Memorandum of alterations reported since ship was surveyed for assignment of Load Lines
in _____

Temporary Alterations for troop carrying:-

Hatch coaming, 3' 8" x 4' 3", port side, after deck, removed and a $\frac{3}{8}$ " riveted plate fitted over hatchway.

Troops' Galley, 12' 6" x 8' 0", built of $\frac{1}{4}$ " steel plate and angles, in way of above mentioned hatchway and adjacent to Crews' bathroom.

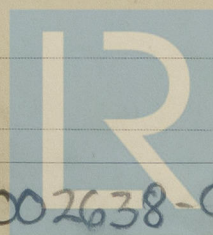
1 set of Wellin Life Boat Davits fitted on Port Side, in way of after end No. 4 Hatchway.

1 set of Welling Lifeboat Davits fitted on Starb'd side in way of after end of No. 4 hatchway.

1 Wooden wash room 27' long erected on after deck, port side, and 1 wooden lavatory 27' long erected on starb'd side after deck. Flush pipes led over gunwale bar.

Forward end of No. 4 'tween deck a wooden bulkhead fitted, held in place by angles tack welded to deck and deck head.

Portable wooden scuttles fitted at Nos . 4 and 5 hatchways. Wood gratings fitted instead of usual hatch covers.

*Noted**BWB**25th March, 1941.**9/5/41.*

© 2020

Lloyd's Register
Foundation