

JUN 1959

Received from Chief Ship Surveyor

SHIP NAME "JALAKRISHNA" REPORT Cal. No. 18861
GB

Standing Conditions of Class:

SUBJECT to shell plate F.11 (p.s.a),
indented stern and set in bulwark plating etc. abreast No.1 hatch, and
to shell plates G.11 (p & s.a) being specially examined and dealt
with by the Special Survey.

ACTION is DEFERRED for Special Survey.

Postponement of Class (B) (As before ~~or None~~)

Days due: SPECIAL SURVEY (C) due 10,58. Postponement until 10,59
approved (8.15.58) following a satisfactory G.E.

Place of Present Survey: (Afloat ~~and in dry dock~~)

Temporary repairs to wasted shell plate:

Equipment - one length of chain cable fractured on account of
bore tide.

Special Features:

Interim Certificate in order (Yes-~~No-None~~)

Outstanding: (If any for S.S. or A.S.)

ALL ITEMS.

to be completed by: 10,59.

Recommendation:


SUBJECT as above, and to 15 fathoms of chain cable being
supplied at the earliest opportunity, and to No.1
plate in 3rd below forecastle sheer (p.s.f)
(wasted & doubled) being specially examined and dealt
with as necessary next drydocking, but further ACTION
be DEFERRED for Special Survey by 10,59.

SUBJECT

IN S.R.L. APPENDIX

Indents in shell plates (p & s).

C.S.S. Records Dept.
to note.

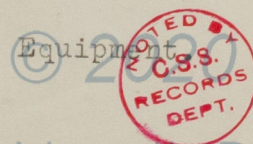

Lloyd's Register
Foundation

002754-002761-0160