

Messrs. The Furness Shipbuilding Co's Nos. 18, 19, 20, 33 & 34.

A letter has been received from the Middlesbrough Surveyors stating the following equipment of anchors and chain cable is proposed to be supplied to these vessels, viz:-


	<u>Rule.</u>				<u>As supplied.</u>			
		cwt.	qrs.	lbs.	cwt.	qrs.	lbs.	
<u>18.</u>	1 bower stockless	77.	0.	0.	77.	0.	0.	
	do.	77.	0.	0.	76.	2.	14.	
	do.	65.	2.	0.	65.	0.	0.	
	Collective weight	219.	2.	0.	218.	2.	14.	
	300 fms. of)							
	2-7/16" stud)	890.	1.	4.	898.	2.	19.	
	chain cable)							
	Collective Wt. of							
	anchors & cable	1109.	3.	4.	1117.	1.	5.	
<u>19.</u>	1 bower stockless	77.	0.	0.	77.	0.	0.	
	do.	77.	0.	0.	77.	1.	14.	
	do.	65.	2.	0.	64.	3.	0.	
	Collective Wt.	219.	2.	0.	219.	0.	14.	
	300 fms. of)							
	2-7/16" stud)	890.	1.	4.	899.	2.	18.	
	chain cable)							
	Collective Wt. of							
	anchors & Cable	1109.	3.	4.	1118.	3.	4.	
<u>20.</u>	1 bower, stockless,	77.	0.	0.	76.	2.	0.	
	do.	77.	0.	0.	77.	1.	0.	
	do.	65.	2.	0.	65.	3.	0.	
	Collective Wt.	219.	2.	0.	219.	2.	0.	
	300 fms. of)							
	2-7/16" stud)	890.	1.	4.	891.	3.	7.	
	chain cable)							
	Collective Wt. of							
	anchors & cables	1109.	3.	4.	1111.	1.	7.	
<u>33.</u>	1 bower stockless	77.	0.	0.	79.	2.	0.	
	do.	77.	0.	0.	74.	2.	0.	
	do.	65.	2.	0.	65.	0.	4.	
	Collective Wt.	219.	2.	0.	219.	0.	4.	
	300 fms. of)							
	2-7/16" stud)	890.	1.	4.	893.	3.	21.	
	chain cable)							
	Collective Wt. of							
	anchors & cables	1109.	3.	4.	1112.	3.	25.	

anchors slightly lighter but cables in excess

anchors slightly lighter but cables in excess

anchors to put cables in excess

anchors slightly lighter but cables in excess

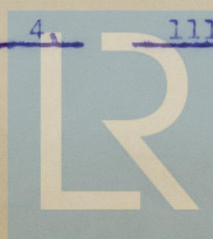

Lloyd's Register Foundation

003307-003310-0124 1/2

0.34.

<u>Rule.</u>	cwt.	qrs.	lbs.	<u>As supplied.</u>	cwt.	qrs.	lbs.
1 bower stockless	77.	0.	0.		77.	0.	7.
do.	77.	0.	0.		78.	2.	0.
do.	65.	2.	0.		64.	1.	18.
Collective Wt.	<u>219.</u>	<u>2.</u>	<u>0.</u>		<u>219.</u>	<u>3.</u>	<u>25.</u>
300 fms. of)							
2-7/16" stud)	890.	1.	4.		896.	0.	0.
chain cable.)							
Collective Wt. of							
anchors & cables	<u>1109.</u>	<u>3.</u>	<u>4.</u>		<u>1115.</u>	<u>3.</u>	<u>25.</u>

anchors
&
cables
in
coils

2 It will be observed that in some instances the anchors are slightly below the Rule requirements, but in all cases the collective weight of the anchors and chain cables is in excess of that required.

It is submitted that in the circumstances the equipment of anchors and chain cable supplied for these vessels might be approved for the figure 1.

24.7.22.

TUE. 25 JUL. 1922

approved.

1/2/22

dr. 22/7/22
and 25th.



© 2020

Lloyd's Register
Foundation

0124 2 1/2