

18 APR 1946

Lloyd's Register of Shipping.

Ship's Name S.S. "LOUISBOURG PARK"

HARMAC CEMAINUS
BOMBAY

Official No. 175363

Memorandum of alterations reported since ship was surveyed for assignment of Load Lines
in February, 1944.

ALTERATIONS:-

No. 5 'Tween Deck

Port Side:- D.E.M.S. Accommodation forward of No.23 bulkhead removed. Access door closed with welded plate and one extra stiffener. Existing bulkhead strengthened by fitting 5" x 3½" reverse angles to existing vertical stiffeners.

Two ventilators (one 12" dia. and one 6" dia.) on upper deck and seven portlights in way removed and openings closed with welded spigot plates.

Star Side:- D.E.M.S. Accommodation forward of No. 24 frame removed and bulkhead moved aft to this position.

One 2'-0" dia. escape hatch on upper deck and four portlights in way removed and openings closed with welded spigot plates.

Cargo battens installed where accommodation removed.

Forward Magazine in No.1 'tween deck removed together with access trunkway, hinged steel W.T. door, and 2 - 10" dia. vents on upper deck in way. Deck openings closed with welded plates and upper deck girder extended and bracketed to collision bulkhead.

After Magazine on Port and Starboard 'tween deck now converted into crew's accommodation and storage space. Two additional 10" dia. portlights installed in way on Port and Starboard sides. Access door to existing accommodation cut in No.11 bulkhead and existing access doorway in fore and aft bulkhead to ammunition trunk closed with welded plate.

All new work satisfactorily hose tested on completion.


D. J. Archibald

SURVEYOR TO LLOYD'S REGISTER OF SHIPPING

Vancouver, B. C.

4th March, 1946.

No copy of this report has been placed on board the ship, being of
Canadian Registry.

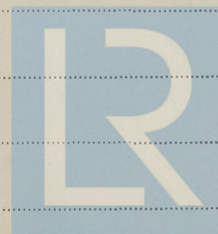

© 2020

Lloyd's Register
Foundation