

21 JUN 1953

Rpt. C. 11 (Contd.)

Index No.

LLOYD'S REGISTER OF SHIPPING

UNITED WITH THE BRITISH CORPORATION REGISTER

Ship's Name

T.E.S. "HYALINA"

Official No.

181843

Memorandum of alterations reported since ship was surveyed for assignment of Load Lines in


alterations in connection with installation of Searchlights on forecable.

A new hatch opening has been cut in the forecable deck forward of the Fore Peak Over Hatch on centre line.

opening $3'-9\frac{1}{2}" \times 3'-4\frac{1}{2}"$, $9" \times 3\frac{1}{2}"$ B.A. coaming, Hinged $\frac{1}{2}"$ cover with heavy packing jointing. Cover stiffened fore and aft by $6" \times 3"$ B.A. closed by $7/8"$ Vaggers, 3 each side.

A small access hatch fitted on top of new cover, $18" \times 13"$ opening, coaming $9" \times 40"$ welded plate, cover rubber jointed hinges $40"$ thick with $4 \times 3\frac{1}{4}"$ dia. Vaggers.

Efficient deck dunnage and underdeck bulk angle fore and aft fitted as compensation for cutting of deck opening and 2 forecable deck beams in bay.

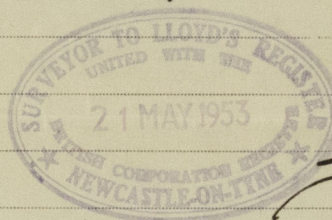

Visitation

Surveyor to Lloyd's Register
Newcastle-on-Tyne
21st May 1953.

A copy of this report has been attached to the Load Line Report C.11 on board.

John

6 JUL 1953



© 2020

Lloyd's Register
Foundation

003479-003486-0206