


COPY

LLOYD'S REGISTER OF SHIPPING

UNITED WITH THE BRITISH CORPORATION REGISTER

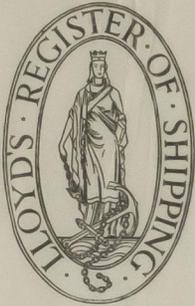

Port SINGAPORE

28th November, 1955.

D.7517

11004

This is to Certify that

R. J. DUNN

the undersigned Surveyor to this Society did at the request of the Owners Representative, attend on board the Steel Screw Steamer "PYILAWTHA", 1785 tons gross of RANGOON, on the 31st July, 1953 and subsequently, whilst afloat and in dry-dock at Singapore for the purpose of ascertaining the nature and extent of alleged damage the cause of which was stated unknown.

Upon examination the undersigned:

FOUND

RECOMMENDED

Shell plate E6 (p.s.) set in and frames and connections in way buckled.

Shell plate E6 to renew buckled frames and connections in way to fair and refit.

Shell plate F5 (p.s.) indented and frames and connections in way buckled.

Shell plate F5 to crop fair and refit.
Frames and connections in way of faired plate to fair and refit.

Shell plate F6 (p.s.) indented and frames and connections in way buckled.

Shell plate F6 to crop fair and refit.
Frames and connections in way of faired plate to fair and refit.

Tween deck stringer plate in way of above slightly buckled.

Tween deck stringer plate to fair and refit.

The above recommendations were made with a view to placing the vessel in as good condition as before the alleged damage was sustained.

over

© 2020

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:—

“While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society.”

COPY


S.S. "PYIDAWTHA"

- 2 -

28th November, 1954.

The foregoing recommendations were satisfactorily completed, oil fittings removed for access replaced and the repairs hose tested and found in good order.

New and disturbed work was efficiently coated on completion.

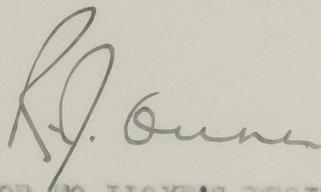

SURVEYOR TO LLOYD'S REGISTER.

at FEE : \$100.00



© 2020

Lloyd's Register
Foundation

0074 2/2