

COPY

26 SEP 1962

ip's name "JALAKANYA"

Port

CAL.

No. 20871

Last survey date 29.8.62.

ass is subject to

indented shell plate No.4 etc. in 2nd below sheer (p.s.f) and to indented plating in 'E' & 'F' strakes frs.52-53 (ps) being examined and dealt with as necessary next drydocking, and to set up keel and bottom shell plating (p & s) being specially examined and dealt with as necessary, also to indented shell plate F.4 (s.s.f) being dealt with by the S.S., and to 15 fathoms of chain cable being supplied at the earliest opportunity.

R.L. Appendix (as before or none)

ture of present survey (afloat and in drydock)

Equipment: Loss of 4 lengths of chain cable and bower anchor.
Supply and verification of 4 lengths of chain cable.


commendation SUBMITTED the ship is eligible to remain as classed, subject as above and to a bower anchor being supplied at the earliest opportunity.

As Now Subject.

IN S.R.L. APPENDIX

Indented No. 5 shell plate
in 2nd below sheer (s.s.f).
Shell plate D.2 (s.s.f) indented.

IT IS FURTHER SUBMITTED the Surveyors be advised it is concluded that they have satisfied themselves that the chain cables now fitted ride satisfactorily over the cable in the.

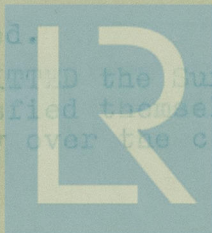

© 2020

Lloyd's Register
Foundation

