


Holes through all Horizontals and Shell plating.

This row of Holes to be drilled in all Horizontals but optional into Shell plating.

Additional length equal to one frame space added to this end as well as the after end of each channel giving 11 extra bolts as fastenings to Hull!

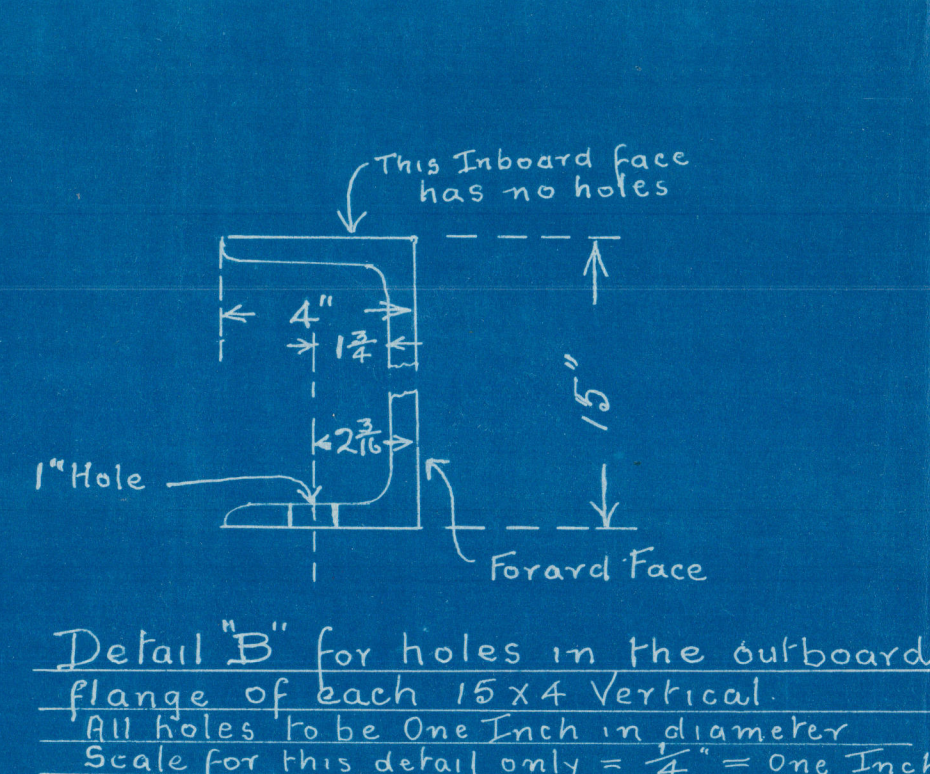

: M.V. "ONDINA" at Fremantle.
Proposed method of Temporary repair.
Note: All repairs are to utilize \square and or Γ section and any section other than these if shown on the drawing denotes existing material.
Scale = One thirty second of an inch = One inch or except details which are made to a scale to suit.
Note: All Holes are to be drilled one inch diameter.
See Drawing of Hull Section for details relating to Struts and Pillar and attachments
Wm. J. Davis Fremantle. December 1942

DRAWING Nº2/W.G.D. "ONDINA"

THE SHELL CO. OF AUSTRALIA LTD.

Scale :	PLAN No.
Drawn	
Traced	
Checked	
Date	

TILLYS LIMITED,
PLAN PRINTERS
278 RAY ST. PERTH

003631-003639-0133



© 2020

Lloyd's Register
Foundation