

due date of the next Periodical Examination. Where it is considered that the vessel is in such a state of repair as to require a special examination, the date of the next examination should be stated. Where it is considered that the vessel is in such a state of repair as to require a special examination, the date of the next examination should be stated. Where it is considered that the vessel is in such a state of repair as to require a special examination, the date of the next examination should be stated.

4E

Port Main Boiler not being used until repaired.

27 OCT 1961

Engineer Surveyor.....

Received from Chief Engineer Surveyor.....

1E

"LIVERPOOL ROVER"

REPORT

HFX


No. 7947.

Docking. Port tailshaft seen.

The Surveyor reports some alleged damage sustained as a result of the propeller striking a submerged object and the port propeller shaft found broken in way of the fillet of the coupling joining the tube shaft at the forward end of the screwshaft. The port screwshaft and propeller found missing also the lignum vitae in "A" bracket damaged. A spare screwshaft and tube shaft also a spare propeller now satisfactorily fitted.

IT IS SUBMITTED that this vessel is eligible to remain as classed with fresh record of TS (CL) P. 9.61.

subject as above

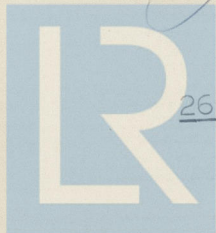

© 20

26.10.61.



Lloyd's Register
Foundation

004153-004159-0061