

reported in the terms of the Rules. The nature and extent of Examinations

COPY.

Lloyd's Register of Shipping.



Port Willemstad, Curacao. N. A.

5th April, 1957.

This is to Certify that

W. S. Holness

Undersigned Surveyor to this Society did at the request of

representative attended on board the M.V. "LINDA" 3217 Tons Gross of
afloat at Curacao. N.A. on 3rd April 1957 and subsequently, on account

stated to have been sustained due to contact with mooring dolphin at
Venezuela on 1st April 1957 when docking in ballast condition at No.1

For further particulars please see vessel's Log Books.

Upon examination the Undersigned:-

- | | |
|---|------------------------------------|
| FOUND | RECOMMENDED |
| lined to starboard side forward. | To be renewed. |
| in 1st & 2nd below main sheer
fractured over length of approx. | To be cropped and part
renewed. |
| rdinal frames buckled over approx.
"10". | |


As a temporary measure a doubling plate was fitted over fractured
peak tank filled and tested upon completion of repairs and all
satisfactory, but it is recommended that it be specially examined
before docking.

W. S. Holness

Surveyor to Lloyd's Register
of Shipping, Curacao. N. A.

Fee & Expenses:- Fls.196.00

This is issued upon the terms of the Rules and Regulations of the Society, which provide that:-
Committees of the Society use their best endeavours to ensure that the functions of the Society are properly
understood that neither the Society nor any Member of any of its Committees is under any circumstances
responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any
Book or other publication of the Society, or for any error of judgment, default or negligence of any of its
Member thereof, or the Surveyors, or other Officers or Agents of the Society."

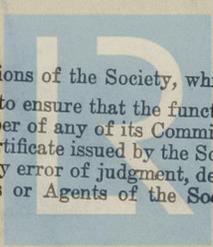

© 2020

Lloyd's Register
Foundation