

2 SEP 1966


SHIP'S NAME "PORT WYNDHAM" PORT LON No. 156972
APPDX...(M) LAST SURVEY DATE 10.8.66.

- CLASS IS SUBJECT TO
1. P.A. aux. eng. No.3 cyl. jacket (ML 8.64) being examined before end of 11.66.
 2. Outb'd air compressor cast iron combined LP/MP piston be specially examined & dealt with as necessary by end of 11.66.
 3. Repaired oil end casting of the aft O.F. transfer pp. being re-examined by 6.67.(12 mons)
 4. Inb'd crosshead guide (ML 1.66) and entablature (fractured at bottom landing of inb'd crankcase door) of the outb'd manoeuvring air compressor be re-examined and dealt with as considered necessary by 9.66 (6 months limit).
 5. Temporary electric power & lighting leaks in E.R. being specially examined & dealt with as necessary upon ship's return to U.K.
 6. Condenser S.W. cooling overb'd discharge valve chest being renewed at N.D.D.

C.S. Advanced.

It is submitted that this
vessel is eligible to remain
as CLASSED. SUBSET-B3

ABOVE

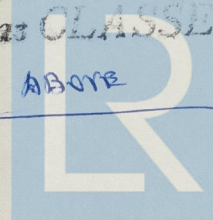

Lloyd's Register
Foundation