

West Coast Shipbuilders Ltd., Vancouver, B.C.

Yard No.145.

Sister vessel to the "FORT COLUMBIA"etc.

5c.7.42

Lake Seamount

N. N. ARCHIPELAGO

F.E.
(FBD)

Received by Chief Ship Surveyor.....

Received from Chief Ship Surveyor.....

VESSEL'S NAME s.s. "WESTON PARK" REPORT Ver. No. 6355

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

D to W dk 37.33' D to 2nd dk 28.58' D for scantlings 36.58' (i.e. 8' above 2nd dk).
 1st Long No. 15217 Depth "d" -
 2nd Long No. 38879 Proportions = $\frac{L}{D}$ 11.14
 Framing As approved Sheerstrake As approved

The scantlings are suitable for a draught of $18\frac{1}{2}$ " in excess of that corresponding to the freeboard which could be assigned as a C.S.S. vessel.

SEE SPECIAL CORRESPONDENCE RE ANCHORS.

This vessel appears to have been built in accordance with the Rules and the approved plans, and it is submitted she is eligible to be classed ~~2100A1~~ "With freeboard" "Fitted for oil fuel 10.44 FP above 150°F"

The Summer Freeboard as shown on the attached extract from the Freeboard Verification Form, now marked on the vessel's sides, to be inserted in the classification certificate and recorded in the Register Book, and further, the remaining freeboards, as shown on the accompanying extract, to be inserted in the certificate of classification.

2 Dks "Part elec. welded"
 Cell DB 368' 1126t, DTa 20' 765t, FPT 148t, APT 160t
 FK, 7BH (Coll to W dk, 6 to 2nd dk) 5 divisional W.T. BHs in 'tween dks., pt. Cem.


O.L. 439.1'

E.S.D.

at
2 $\frac{1}{16}$ "

The class is assigned and maintained upon the understanding that the equipment will be made to accord with the requirements of the Rules and the two bower anchors and stream anchor on board submitted to the Statutory Test when the present state of emergency has passed.

Insert in S.R.L.:- (A bower anchor to be supplied and 2 bower anchors and stream anchor on board to be submitted to the Statutory Test).

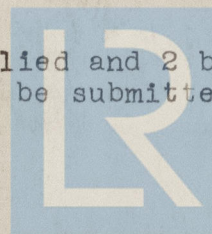

© 2020

Lloyd's Register
Foundation

6.12.44.

004789-004798-0368

Spacing

DOUBLE BOTTOM.

2" @ 30"