

115 JUL 1965

Ship's name KAVO MATAPAS

Port Bilbao.

No. 13939.

Class is subject to :-

Last survey date 17.3.65

1. The propeller & fastenings (Grounding) being specially examined at the next drydocking.
2. The port main boiler being re-examined & repaired as necessary on arrival at Bilbao.

Docking :- Wear down 2.3 mm.


TS(OA) :- Due $\frac{8}{66}$, now held.

MBS :- Due $\frac{7}{64}$, now reheld, previously commenced $\frac{9}{64}$.

SPS :- Due $\frac{5}{64}$, now held.

Subject Item 1 :- All four badly distorted blades now failed and propeller refitted. It is submitted this Condition of Class be withdrawn.

(continued)

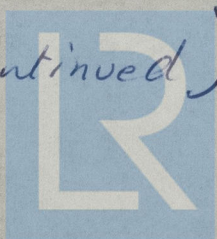

© 2020

14.7.65

Lloyd's Register
Foundation

004918-004926-0165 1/2

Ship's name

KAVO MATAPAS

Port

Bilbao

No.

13939

Class is subject to

Last survey date

(continued)
Subject Item 2.

The Surveyor reports considerable repairs to the port boiler including part renewal of all three combustion chamber back plates and port furnace, the fairing of the centre and starboard furnaces and the renewal of plain tubes and combustion chamber stays as required. He also reports the renewal of 133 plain tubes and 3 combustion chamber stays in the starboard boiler. Port boiler hydraulically tested on completion of repairs. It is submitted this Condition of Class be withdrawn. The main condenser has been tested and 3 leaking tubes renewed.


It is submitted that this vessel is eligible for THE RECORD. MBS $\frac{3}{65}$ TS (09) $\frac{3}{65}$ and SPS $\frac{3}{65}$ without subject.

JWB.

14.7.65.

Inform Surveyor of the Conditions of Class requesting him to issue an Amended Interim Certificate, requesting recommending their withdrawal.

19/7

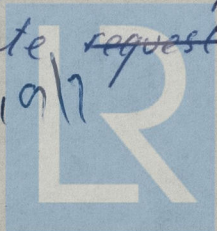

Lloyd's Register
Foundation

004918-004926-0165 2/2