

23 MAR 1960

## LLOYD'S REGISTER OF SHIPPING

NEWCASTLE-ON-TYNE, No. F-5251

## ALTERATIONS TO CONDITIONS OF ASSIGNMENT OF LOADLINES

Ship's Name "ORSOVA"

Official No. 18607.

Port of Registry LONDON

43459

This ship has been under survey at WALLSEND AND WALKER ON TYNE

on *January to March* 1960. and the following alterations to the conditions of assignment of loadlines have now been effected/~~found~~:-

The following 14" dia. sidelights were "blanked off" by fitting welded doubling plates and spigot plates to shell apertures.

	<u>Port</u>	<u>Starboard</u>
"D" Deck Frame Nos.	98-99	62-63
	164-165	63-64
	165-166	109-110
	108-109	164-165
	113-114	165-166
"E" Deck	180-181	180-181
"F" Deck	33-34	33-34
"G" Deck	82-83	191-192
	94-95	82-83
		94-95
		114-115
		119 -120
		123 -124
		170 -171

The following 14" dia. sidelights with corresponding deadlights were fitted as follows:

	<u>Port</u>	<u>Starboard</u>
"D" Deck Frame Nos.	97-98	61-62
	107-108	64-65
	114-115	118-119


Cargo shell door in Galley space P & S sides

Sidelight "blanked off" by E.W. doubling plate and doors stiffened by fitting two welded flats across doors.

*J.L. Roberts* 12/3/60.  
J.L. ROBERTS.

*Noted  
JMB  
25/3/60*

A copy of this Report has been placed on board.

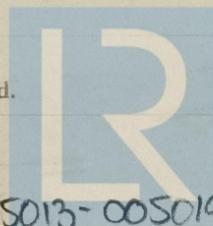

© 2021

Lloyd's Register  
Foundation

005013-005019-0073