



LLOYD'S REGISTER OF SHIPPING

95, Bothwell Street, Glasgow, C.2

Telegrams: Register, Glasgow, Telex
Telex No.: 77530


Telephone: Central 6491 (7 Lines)

4th November, 1965.

Please address further
communications on this subject
to THE SECRETARY
and quote the following
reference

Ref:C

Classn.

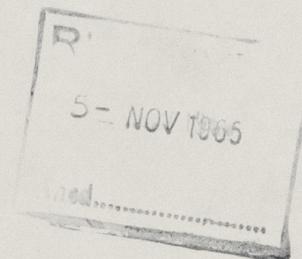

Dear Sir,

s.s. "TASSIA"

I am in receipt of your letter of the 1st
November with its enclosures.

The Surveyor states that the condition of
the cables on this ship are as stated in Glasgow Report
No. 96530 and that all cables aboard were ranged and
gauging taken in five places per length, verified by the
ship's Master, before replacing 90 fathoms of new cable
supplied.

In view of these gaugings, the most worn
lengths were replaced leaving the three additional lengths,
as reported, to be renewed. These additional lengths are
as stated, Nos. 1, 2 & 3 port side (adjacent to anchor) and
measure $38 \times 42\frac{1}{2}$, 39×43 and 37×43 m.m. respectively
(renewal size - $42\frac{1}{2}$ m.m.).

The lengths of cable referred to in the Owners'
letter of the 6th October which were renewed in 1963 were
identified by gauging and are now placed No.7 (port side)
and Nos. 4 & 5 (starboard side).

The Surveyor further states that the remaining
seven lengths were approaching the minimum mean dimensions
and that the Master was requested to inform the Owners of
the condition of this cable and to make arrangements for
renewal at the next Special Survey.

Yours faithfully,

The Secretary,
LONDON.

© 2020
Spowden
Secretary to the
Scottish Committee.

Lloyd's Register
Foundation

005174-005179-0269

SR.
REPORTS

Handwritten initials/signature

*Noted
L.F.C.
15-11-04*



© 2020

Lloyd's Register
Foundation