

VERIFICATION REPORT

Form No 9 ATTACHED

SUNDERLAND RPT. No. 27120

WRITTEN. *Spence 25367*

Lloyd's Register of Shipping.

SURVEYS FOR FREEBOARD.-STEAM SHIPS. *25520*

REGULARS RELATING TO ALL STEAM SHIPS EITHER FLUSH DECKED OR WITH GALLANT FORECASTLES, SHORT POOPS AND BRIDGE HOUSES DISCONNECTED, OR TOP GALLANT FORECASTLES HAVING LONG POOPS, OR RAISED QUARTER DECKS CONNECTED WITH BRIDGE HOUSES, OR OTHERWISE.

Port of Survey SUNDERLAND  
Date of Survey Dec 17<sup>th</sup> 1917  
Name of Surveyor T. J. LEATHARD

Short Spool No 412  
Ship's Name. F. A. "TEAKOL"  
Port of Registry and Nationality. LONDON  
BRITISH  
Official Number. 142290

Gross Tonnage. 1137  
Date of Build. 1917  
Particulars of Classification. +100.A.1. "STEEL" (CARRYING PETROLEUM IN BULK) CONTAMPLATED

LENGTH.	BREADTH.	DEPTH.	UNDER DECK TONNAGE.
210.0	34.8	16.6	880.35
210	34.63	16.84	905.35

Moulded Depth as measured..... 16'6"  
Addition for Keel below base line for draught record..... inches.

NOTE. - If the depth is measured when vessel is afloat, the details of measurement should be reported.

Efficient of fineness..... .739  
Modification necessary [Para. 4 (a) to (e)]\*  
Efficient as corrected .....

CORRECTION FOR LENGTH.  
Length of Ship on Loadline..... 210  
Length in Table ..... 198  
Difference ..... 12  
Correction for 10ft., Table A. .... 1.0 Table C.  
× Difference divided by 10 ..... 1.2 (if required.)  
If  $\frac{1}{10}$ ths length covered divide by 2 .6 + 1/2

Mean Sheer { Stem..... 36 }  $54 \div 2 = 27$  ... Mean 36  
                  { Sternpost ... 18 }

CORRECTION FOR IRON DECK.  
Proportion covered, if less than  $\frac{1}{10}$ ths length covered ..... .743  
Thickness of usual wood deck, less stringer ..... 3

Mean Sheer at  $\frac{1}{3}$  of the length from { Stem 24 }  $36 \div 2 = 18$  ... Mean 32.72  
  { Sternpost 12 }  $\div .55 = 32.72$   
Standard mean Sheer [Table, Para. 18] ..... 31  
Difference.....  $1.14 \div 4 =$  + 4

CORRECTION FOR ROUND OF BEAM.  
Breadth at Gunwale amidships..... 34'7 1/2  
Round of Beam ..... 9 3/4  
Normal round..... 8 3/4  
Difference .....  $\div 2 =$  ✓  
Proportion of Deck uncovered (Para. 19) .....

NOTE. - The round of beam should be reported on the full breadth of vessel at the gunwale.

Rise in Sheer { At front of bridge house.....  
from amidships [Para. 18 (e)] { At after end of forecastle .....

Freeboard, Table A ..... 2-10 1/4  
Correction for Sheer ..... + 1/4  
Correction for Length ..... + 1/2  
Allowance for Deck Erections ..... 2-10 3/4  
Correction for Round of Beam..... ✓  
Correction for fall in Sheer (if any).....

Freeboard, Table C..... 8 1/2  
Correction for Length, if required (Para. 12, 13, and 14) .....

Correction for Iron Deck (if required) ..... - 3  
Additions for non-compliance with provisions of { Para. 11 (d) and (e) } ..... 2-5 1/2

Freeboard by Table A, corrected for sheer, and for length, if required (Para. 12, 13, and 14) } 2-10 3/4  
Difference ..... 48%  
Percentage as below..... 12 1/4

Other Corrections (if any) Addition to correspond to draught of 12'6" desired by Admiralty  
Winter Freeboard .....  
Summer Freeboard .....  
Indian Summer Freeboard .....  
N. A. Winter Freeboard ..... } 4-1

Correction for R. Q. Dk. if engine and boiler openings not covered by bridge house (Para. 11)  
Allowance for Deck Erections .....

Correction necessary because clearside amidships, measured in accordance with the Statute is not taken at the intersection of the wood or iron deck with side. nil  
Winter Freeboard from deck line .....  
Summer " " " " ..... } 4-1  
Indian Summer " " " " .....  
N. A. Winter " " " " .....

	Length.	Length allowed.	Height.
Forecastle... <i>side</i>	<u>40.5</u>	<u>48.5</u>	<u>7-0</u>
Bridge House	<u>14.5</u>	<u>33.3</u>	<u>"</u>
Side Poop	<u>53.5</u>	<u>61.5</u>	<u>"</u>
Centre Poop	<u>69.5</u>	<u>148.3</u>	<u>"</u>
Total		<u>210</u>	<u>.68</u>


Corresponding percentage (Para. 11, 12, 13, or 14) } 48%  
FREEBOARD recommended amidships from centre of Disc to top of Statutory Deck Line, Wood (Iron) Deck :-  
Fresh Water Line above centre of Disc .....  
Indian Summer Line " " " " .....  
Winter Line below " " .....  
Winter North Atlantic Line " " " " .....

4'-1" for all seasons  
3

\* If the frames, skin planking, or ceiling are of unusual thickness the breadth of vessel to inside of ceiling should be reported if possible.  
† In vessels obtaining an allowance for deck erections under Para. 11 where the sheer drops abaft amidships the height of the R. Q. D. is to be taken from the level of the top of the amidship beam.  
‡ In flush-decked vessels the total standard mean sheer means the sheer measured at the stem and stern-post. In vessels having poops and forecastles, it means the sheer measured at points distant one eighth of the vessel's length from stem and stern-post.

† State dimensions of freeing port area on back of this form.  
‡ The Surveyor should state whether the fall in sheer as reported is measured relatively to the straight line of keel or to the water line. If measured relatively to water line the vessel's draft at time of survey, and also the usual load draft forward and aft should be reported.

21. 12. 17.

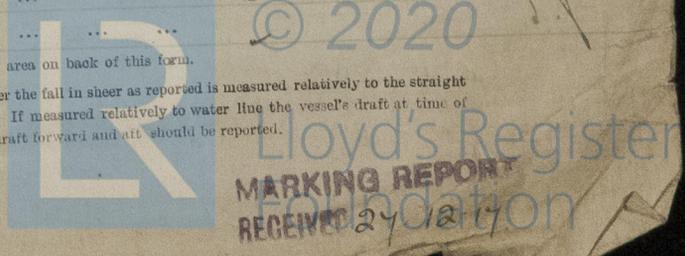

005470-005479-0079

Do all the Frames extend to the top height in the Poop? *Yes* Raised Quarter Deck?  Bridge House?  Forecastle? *Yes*

To what height do the Reverse Frames extend? *LONGITUDINAL FRAMING IN WAY OF OIL TANKS.*

Has the Poop or Raised Quarter Deck an efficient Iron Bulkhead at the fore end? *Yes*

Give particulars of the means for closing the openings in Bulkhead *NO OPENINGS*

Is the Poop or Raised Quarter Deck connected with the Bridge House? *FORECASTLE YES BY CONTINUOUS TRUNK.* Has the Bridge House an efficient Bulkhead at the fore end?

Give particulars of the means for closing the openings in Bulkhead

What is the thickness of the Bridge Front plating?  and Coaming plate?

Give scantlings and spacing of the Stiffeners

Are bracket plates fitted at each end of the Stiffeners?  Are hor'l. brackets fitted connecting Bridge Bulk'd. with Bulwarks?

Has the Bridge House an efficient Iron Bulkhead at the after end?

How are the openings closed?

Is the Forecastle at least as high as the main or top-gallant rail? *Yes* Has the Forecastle an efficient Iron or Wood Bulk'd. at after end? *Yes*

Are the Engine and Boiler openings covered by a Bridge, Poop, Raised Quarter Deck or enclosed by a Strong Iron or Steel Deckhouse? *Yes*

If the openings are not so protected are the exposed parts of the Casings efficiently constructed?

Give thickness of plating; scantlings and spacing of Stiffeners

What is the height of the exposed Casings? *7'0"* Are suitable means provided for closing all openings in them in bad weather?

Are the Weather Deck Hatchways efficiently constructed and at least equal to the requirements of Section 28 of the Rules for 1904-5? Give particulars below:—

Position and Size.		Ship.		Rule.		Ship.		Rule.		Ship.		Rule.	
Item.													
COAMING	Height above top of DECK												
	Thickness { Sides..... Ends.....												
SHIFTING BEAMS OR WEB PLATES.	Number .....												
	Section and Scantlings .....	<i>WATERTIGHT HATCHES TO OIL TANKS ONLY</i>											
	Material .....												
* FORE AND AFTERS.	Number .....												
	Section and Scantlings .....												
	Material .....												
HATCHES	Thickness .....												
	Remarks.....												

\* The depth of Fore and Afters should be stated from the underside of the hatches in all cases.

(If the sill of the lowest side scuttle will be less than 6 inches above the Indian Summer Load Line if assigned under the tables, state vertical distance from top of deck at side amidships to lower edge of lowest side scuttle.)

The following information is to be given in all cases of vessels dealt with under Paras. 11, 12 (under 15 feet Moulded depth) and under Shelter Deck Rules.

What is the thickness of the Bridge Sheerstrake? \_\_\_\_\_ Strake between Main and Bridge Sheerstrakes? \_\_\_\_\_


Delete the words { The Crew are, are not, berthed in the bridge house.  
that do not apply { The arrangements to enable them to get backwards and forwards from their quarters are, are not satisfactory.

Length of Bulwarks in well \_\_\_\_\_

Area of Freeing Ports required by Para. 11 (e) each side of vessel = \_\_\_\_\_ Sq. ft.

Ft.	Tenths.	Ft.	Tenths.	No.	} Freeing Ports (each side of vessel)	= _____ Sq. ft.
	x		x			
	x		x			

Total deficiency or excess = \_\_\_\_\_ Sq. ft.

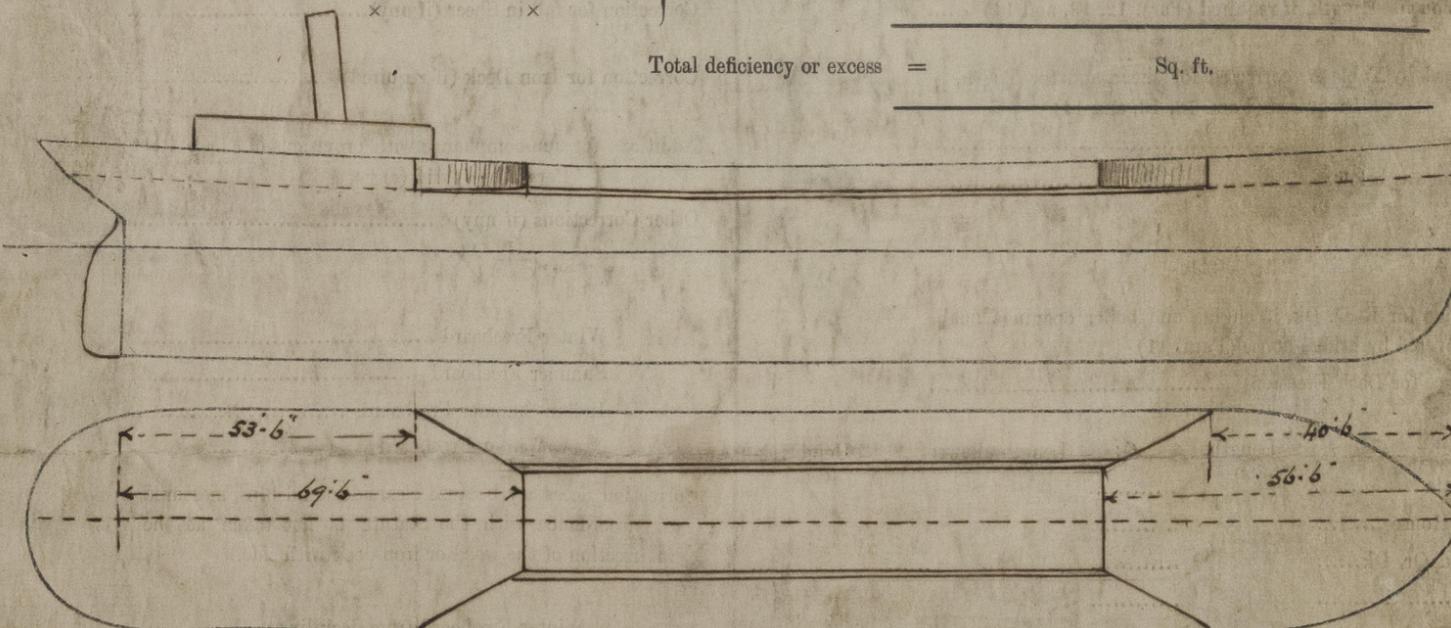

Show hereon line of Floors or Tank Top with position of any Breaks in same; also height of Peak Tank tops, &c., &c.

State any special features in the construction of the Vessel *"CARRYING PETROLEUM IN BULK" ENGINES AFT.* *General*

*THE APPROVED PLANS ARE ENCLOSED FOR REFERENCE. THIS VESSEL IS A DUPLICATE OF R.F.A. "TANKOL"*  
*See No. Report No. 27068 AND SECRETARY'S LETTER DATED OCT. 9<sup>TH</sup> 1917*

Owners \_\_\_\_\_

Address \_\_\_\_\_

*[Signature]*

Received by me \_\_\_\_\_



Lloyd's Register  
Foundation