

COPY.

Lloyd's Register of Shipping.

AUG -2 1940



Port YOKOHAMA.

6th May, 1940.

Certificate No. 2676.

100A1
This is to Certify that

K. Kishigami,

the undersigned Surveyor to this Society did at the request of the Owners, attend on board the Single Screw Steamer "TIHUKU MARU" 5857 tons gross, of Hasidate, on the 6th May, 1940, whilst the vessel lay, afloat, in Yokohama Harbour, for the purpose of examining the Anchors, Chain Cables, Windlass, and other Mooring Gear, prior to the vessel's departure for Christmas Island, to load cargo.

The port and starboard bower anchors, the spare bower anchor, and the stream anchor were examined, found in good condition, and in accordance with the Society's requirements.

The vessel is equipped with 270 fathoms of $2\frac{3}{16}$ " stud link chain cable in accordance with the Society's requirements, 135 fathoms in each hawse pipe, and the stream chain, towline, and hawsers and warps were also found to be in satisfactory condition.

The steam-driven windlass was examined under working condition while the port chain cable and anchor was run out, the starboard chain cable which was attached to No. 14 buoy, also run out afterwards anchor and cable hove in, both separately and simultaneously, and found to be in satisfactory working condition. The cable lifters, brakes, and stoppers were

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:—*Continued.*


"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

So.S. "TIHUKU MARU".


examined and found in good order.

The steam mooring winch, aft, with its warping ends was examined and found in good working order.

As a result of the foregoing examination the undersigned is of opinion that the Anchors, Chain Cables, Windlass, and other Mooring Gear, are now in satisfactory working order, and condition.

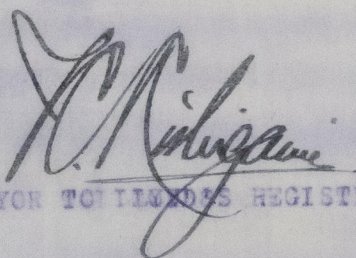

SURVEYOR TO LLOYD'S REGISTER.

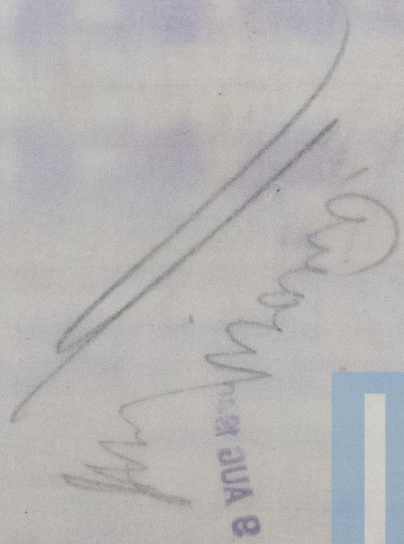



© 2020

Lloyd's Register
Foundation

008201-008210-0098

RECEIVED 21/12/2020

COPIES

- 2 -

"UPON UPONIT" - 2.02

above report of the ship's crew and the ship's log.

above report of the ship's crew and the ship's log.

above report of the ship's crew and the ship's log.

[Signature]

RECEIVED

Referred to the Chief Ship Surveyor.

[Signature]

[Signature]

Also for Mr. Skidder to note

[Signature]

9 AUG 1940

© 2020

Lloyd's Register Foundation