

S.S. "E D E R A"

=====

FREE TRANSLATION OF ANCONA SURVEYOR'S REPORT IN LETTER FORM
DATED 28/1/28.

=====

In accordance with information received from the Naples Surveyors
and at the request of the Captain, carried out main boiler survey.

=====

R E P O R T

=====

20/1/28 - Port Main Boiler examined internally and externally
=====

Recommended lower manhole door faces to be built up
=====

and also some wastage on waterside of combustion cham-
ber/ plating of port and starboard chambers at the
back
height of upper row of screw stays.

Safety, feed, and blow off valves good.

24/1/28- Starboard Boiler examined internally & externally
=====

Recommended lower manhole door faces to be built up.
=====


Internally boiler in good condition.

Safety, feed and blow off valves good.

27/1/28- Safety valves adjusted under steam to 170 lb.W.P.
=====

=====

N.B. The above mentioned repairs may be carried out within the
first 6 months of this year.

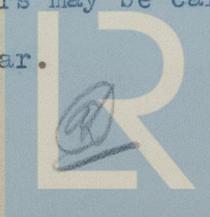

© 2021
Lloyd's Register
Foundation

008648-008655-0322