

## REPORT ON ELECTRICAL EQUIPMENT.

(OTHER THAN FOR THE PROPULSION OF THE VESSEL)

21 FEB 1945

Received at London Office.....

Date of writing Report... 8.1.45... When handed in at Local Office... 26.1.45... Port of... Liverpool

No. in Survey held at... NORTHWICH... Date, First Survey... 19/9/44... Last Survey... 16/11/45  
Reg. Book. (Number of Visits... 8...)66628 on the M.V. "EMPIRE TAPLEY" Tons { Gross... 305  
Net... 103

Built at... NORTHWICH... By whom built... Isaac PIMBLOTT &amp; SONS LTD. Yard No. 662 When built... 1945

Owners... MINISTRY OF WAR TRANSPORT... Port belonging to... LIVERPOOL.

Electrical Installation fitted by... THE SUNDERLAND FORGE &amp; ENG. CO. LTD... Contract No. 662 When fitted... 1945

Is vessel fitted for carrying Petroleum in bulk... YES... Is vessel equipped with D.F. No. E.S.D. No. Gy.C. No. Sub.Sig. No.

Have plans been submitted and approved... YES... System of Distribution... Two wire... Voltage of supply for Lighting... 110

Heating... Power... Direct or Alternating Current, Lighting... D.C. Power... If Alternating Current state periodicity... Prime Movers,

has the governing been tested and found as per Rule when full load is suddenly thrown on and off... YES... Are turbine emergency governors fitted with a

trip switch as per Rule... Generators, are they compound wound... YES... are they level compounded under working conditions... YES...

if not compound wound state distance between generators... and from switchboard... Where more than one generator is fitted are they

arranged to run in parallel... YES... are shunt field regulators provided... YES... Is the compound winding connected to the negative or positive pole

negative... Have machines over 100 kw. been inspected by the Surveyors during manufacture and testing... Have certificates of

test for machines under 100 kw. been supplied... YES... and the results found as per rule... YES... Are the lubricating arrangements and the construction

of the generators as per rule... YES... Position of Generators... In Engine Room (one port &amp; one starboard side)

is the ventilation in way of generators satisfactory... YES... are they clear of inflammable material... YES... if situated

near unprotected combustible material state distance from same horizontally... and vertically... are the generators protected from mechanical

injury and damage from water, steam and oil... YES... are the bedplates and frames earthed... YES... and the prime movers and generators in metallic

contact... YES... Switchboards, where are main switchboards placed... In Engine Room near starboard generator.

are they in accessible positions, free from inflammable gases and acid fumes... YES... are they protected from mechanical injury and damage from water, steam

and oil... YES... if situated near unprotected combustible material state distance from same horizontally... and vertically... what insulation

material is used for the panels... Swidanyo... if of synthetic insulating material is it an Approved Type... YES... if of

semi-insulating material (slate or marble) are all conducting parts insulated therefrom as per Rule... Is the frame effectually earthed... YES...

Is the construction as per Rule... YES... including accessibility of parts... YES... absence of fuses on the back of the board... YES... individual fuses

to pilot and earth lamps, voltmeters, etc... YES... locking of screws and nuts... YES... labelling of apparatus and fuses... YES... fuses on the "dead"

side of switches... YES... Description of Main Switchgear for each generator and arrangement of equaliser switches... Double pole switch

and double pole fuses

and for each outgoing circuit... Double pole change over switch and double pole fuses.

Are compartments containing switchboards composed of fire-resisting material or lined as per Rule... Instruments on main switchboard... 3

ammeters... 2... voltmeters... synchronising devices. For compound machines in parallel is the ammeter connected on the pole opposite to the

equaliser connection... Earth Testing, state means provided... Earth Lamps.

Switches, Circuit Breakers and Fuses, are they as per Rule... YES... are the fuses an approved type... YES... are all fuses labelled as

per Rule... YES... If circuit breakers are provided for the generators, at what overload current did they open when tested... are the reversed current


protection devices connected on the pole opposite to the equaliser connection... have they been tested under working conditions, and at what current

did they operate... Joint Boxes, Section Boards and Distribution Boards, is the construction and position as per Rule... YES...

Cables, are they insulated and protected as per the appropriate Tables of the Rules... YES... if otherwise than as per Rule are they of an approved type... YES...

state maximum fall of pressure between bus bars and any point under maximum load... 1.216/4... are the ends of all cables having a sectional area of 0.0226

square inch and above provided with soldering sockets... YES... Are paper insulated and varnished cambric insulated cables sealed at the ends... YES...

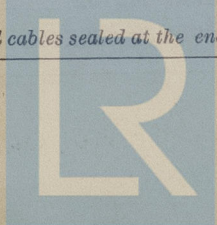



and found satisfactory.....*750*.....\*

0094 2/2



The Electrical Equipment is installed in accordance with the approved plans and the requirements of the Rules.

All Insulated Conductors are guaranteed to have been tested at the maker's works as specified in the Rules.

The foregoing is a correct description.

*J. Williamson*  
P. Pro. THE SUNDERLAND FORGE & ENGINEERING CO. LTD. Electrical Engineers. Date 22 Jan 1945

#### COMPASSES.

Minimum distance between electric generators or motors and standard compass.....

Minimum distance between electric generators or motors and steering compass..... 56 ft

The nearest cables to the compasses are as follows:—

A cable carrying 7 Ampères ..... feet from standard compass ..... 7 feet from steering compass.

A cable carrying 0.1 Ampères ..... feet from standard compass led into feet from steering compass.

A cable carrying ..... Ampères ..... feet from standard compass ..... feet from steering compass.

Have the compasses been adjusted with and without the electric installation at work at full power Yes

Has the effect of switching on and off circuits, motors and other electro-magnetic apparatus within the vicinity of the compasses been noted Yes

The maximum deviation due to electric currents was found to be ..... degrees on ..... course in the case of the standard compass, and Nil degrees on any course in the case of the steering compass.

FOR ISAAC PIMBLOTT & SONS LTD.

*John Pimblott* Builder's Signature. Date 25/1/45

Is this installation a duplicate of a previous case Yes If so, state name of vessel EMARE COCKETER.

Plans. Are approved plans forwarded herewith No. If not, state date of approval 30.6.43

Certificates. Are certificates of test for motors engaged on essential services and generators forwarded herewith Yes.

General Remarks (State quality of workmanship, whether insulation tests, etc., have been made, opinions as to class, etc.) The electrical

equipment of this vessel has been installed under special survey and in accordance with the approved plans and specifications. The installation has been tested under full working conditions and found satisfactory. The materials and workmanship are good.

Noted

Thurs 5.3.45

Total Capacity of Generators 10. ✓ Kilowatts.

The amount of Fee ..... £ 10 : 0 : 0  
+2% Specification £ 2 : 0 : 0

Travelling Expenses (if any) £ 3 : 15/3

When applied for,  
14 FEB 1945

When received,  
.....19.....

*L. Haffner*

Surveyor to Lloyd's Register of Shipping.

Committee's Minute LIVERPOOL 20 FEB 1945

Assigned See Minute on Liverpool L.E. Machinery Report.