

COPY



Hong Kong

August 10th. 1928.

This is to Certify that

T. S. MORRISON

the undersigned Surveyor to this
Society did at the request of

Messrs Columbia Pacific Shipping Company proceed on board the
S. S. "DAVID C. REID" of New York, ex "SILVERBROOK" of London,
6135 Gross Tons, No. 34970 in the Register Book, in order to
ascertain the nature and extent of the damage stated to have
been sustained by the vessel encountering a typhoon on July 30th.
1928, while on voyage from San Pedro to Hong Kong.

For further particulars see Ship's Logs.


Upon examination

FOUND

Starboard companion door
frame amidships, sprung.
Port door hinges loose.
One hinge on Port door
to fore-castle broken.
Handrails on Port fore-
castle ladder & Port
bridge ladder broken.
Six scuttle ports on
Starboard side of Fore-
castle damaged.
Canvas cover of Port
Lifeboat on bridge
carried away.
Port & Starboard handrails
on poop damaged.

RECOMMENDED

Door and frame to be refitted.
To be refastened.
Hinge to be renewed and fitted.
To be repaired.
To be renewed & refitted as
necessary.
To be renewed.
To be repaired.

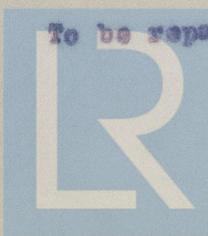

© 2021

Lloyd's Register
Foundation

009815-009826-0153 1/2

S.S. "DAVID C. REID" ex "SILVERBROOK".

FOUND

Electric wiring and pipe conduit carried away on Starboard side trunk deck.

Galley stove funnel carried away.

Steam pipe covers on deck started from fastenings.

Main steam pipe from Starboard boiler broken at flange.

Spur wheel with attached spindle of Telemotor gear on bridge, broken.

RECOMMENDED

To be renewed.

To be renewed and fitted.

To be refastened.

Pipe to be renewed, tested and fitted.

To be renewed.

All removals necessary to carry out the above repairs to be replaced in order.

The above recommendations have now been satisfactorily carried out.

NOTE :- It was further stated that, during the typhoon, four drums containing lubricating oil and three empty drums were washed overboard, also that the Engineers of the vessel had renewed eight lengths of 3 $\frac{1}{4}$ " deck exhaust pipes which had been damaged, pipes being used from vessel's spare gear.

W. Morrison
SURVEYOR TO LLOYD'S REGISTER
HONGKONG

Survey fee - - - - - \$120.00.

Travelling expenses \$ 30.00.



© 2021

Lloyd's Register
Foundation