

A. LE MARREC

EXPERT MARITIME ASSERMENÉ
PRÈS LES TRIBUNAUX DU MAROC

3. RUE DE CHAMPIGNY
CASA BLANCA

TÉL. 419-57

RAPPORT D'EXPERTISE

TANKER " EL KARIM "

ANNUAL SURVEY

At the request of Owners
and

by order of M. L. BARBER Ltd Lloyd's Agent at CASABLANCA

I the undersigned surveyor do Hereby Certify that I have examined
the vessel afloat and in dry dock and ascertained the following.

PARTS EXAMINED

RECOMMENDED

HULL

The vessel was in dry
dock from the 18/I/1958 to
the 30/I/1958

The hull is in a general-
good condition

The hull has been graved and painted
with two coatings.

- The strainers and inlet valves have
been examined and found and/or put in
good condition.

SUPERSTRUCTURES

The St lower part of the
superstructures has been
found in badly condition

- The badly parts has been doubled by
plate 6% thick. 1m20 height 6m Long.

CHAIN CABLES

- St chain cable is at its
limit of wear

- four shackles to be renewed as soon as
possible.

Pt SCREW SHAFT

- has been renewed as recommended in
report Dated 6/2/1957
Certificate of L R S
N° C 2954 - 11 Octobre 1957
issued at MARSEILLE

MACHINERY

MAIN MOTORS

St MOTOR



© 2021

Lloyd's Register
Foundation

010004-010011-0038 1/2

./.

St MOTOR

- Cover - valves : - have been examined found and/or put
- Liner : in good condition
- Pistons :
- Top and bottom end connec- :
- ting rod :
- Thrust block :
- Crank pins :
- Main bearings :

Pt MOTOR

- Cover - valves : - have been examined found and/or put
- Liner : in good condition
- Pistons :
- Top and bottom end connec- :
- ting rod :
- Crank pins :
- Thrust - block :
- Main bearings :
- Bilges pumps } attached : - examined found and/or put in good con-
- Circulating pumps } : dition

OIL COOLERS

: - have been cleaned and tested.

MAIN AIR COMPRESSOR

: - examined found and/or put in good con-
: dition.

Pt GENERATOR UNIT

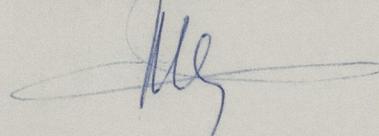
: - examined found and/or put in good con-
: dition.

ELECTRIC CIRCUIT

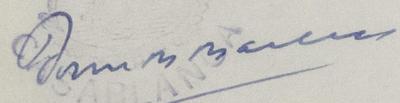
: - has been tested and put in good condi-
: tion.

SUMMARY : the Parts of Hull and Machinery having been found and/or put in good condition. I consider that the vessel can proceed on her duties subject that four shackles of St chain cables be renewed as soon as possible.

Casablanca 12 Février 1958


Surveyor appointed by Lloyd's Agent

LLOYD'S AGENCY


CASABLANCA

P. PONS & L. BARBER LTD



© 2021

Lloyd's Register
Foundation

0038 2/2