

COPY

Ship's name METROPOLITAN

Port

KOB.

No. 12407

Last survey date 11/1/64

Class is subject to :-

- (1) Propeller and outside fastenings being specially examined at next dry docking
- (2) M/E N° 3 cylinder liner (Wb et al tested 9/63) being examined and dealt with by 1/64 (3 mm limit)

Docking Wear down } prior renewal 3.6%
 } after renewal 1.3%

TS due 10/63 now held.

ABS due 11/63 now held.

CSM advanced.

SRL Item (1) Propeller examined, two blades found to have small section missing from tips but considered to remain efficient. Stem shaft examined, crack detected as found. cracked circumferentially at large end of taper. Shaft rejected and spare unused. Shaft fitted. The stem to delete from the list.


Item (2) ~~The~~ dealt with, then now renewed, and stem to delete from the list.

Wear and tear repair - M/E N° 3 piston found cracked in way of piston ring landing, spare piston fitted. also M/E attached to pump casting found broken now renewed

It is submitted that this vessel is eligible for THE RECORD.

TS(EL) M } 1/64
ABS }

For CSM See Form 7C

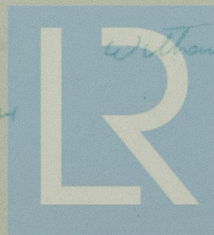

© 2021

Lloyd's Register
Foundation