

25 NOV 1963

Ship's Name ~~SS~~MS "MOBIL FLAME"

Gross tons

Is there a rpt. 8?

Port of Rotterdam

Rpt. No. 57176

No. of visits

First date

Last date

Interim Cert. issued
& copy herewith?Damage rpt. issued
& copy herewith?

Last rpt. (H.Q. only)

Date of
completing rpt.

Surveyed at, if different from Port above

Is a rpt. 9A
attached?

MN

Nature of survey Dam. rep. to windlass
and forced draught fan-
motor.

Survey fees

Damage fee

Expenses

S.A. fee

DOCKING

Propeller

Sea connections

Oil gland

Fastenings

Wear down of stern bush

Has screw/tube
shaft been drawn?

Date of examn.

Has shaft been
changed?

Has shaft now fitted been previously used?

Has shaft now examined/fitted a continuous liner?

Approved oil gland?

BOILERS OPENED UP AND EXAMINED. (Identify by position and state latest date of internal examination of
each boiler.)

AUXILIARY, DONKEY OR PRESS

(State if oil fired—OF
or exhaust gas—EG)

MAIN

Air heaters

Superheaters

Safety valves

Mountings, doors
and fasteningsSafety valves { Sat
adjusted to { SptBoiler securing
arrangements

Main economisers

Exhaust gas heated economisers

Steam heated
steam generators

Steam generator safety valves adjusted to

Forced
circulating pumps

Funnel

Have saturated steam pipes in cylindrical boiler
smoke boxes been examined as required by the Rules?Were oil burning system &
remote controls examined
in accordance with rules ?

I recommend that the machinery of this ship remain as classed with/without fresh record of

See report 9A.

(Where conditions of class are recommended to
be retained, imposed, amended or deleted, particulars
must be stated above and on the interim certificate.)

Date of Committee

Minute

THURSDAY 12 DEC 1963
See Rpt 9AF.P. Crum.
Surveyor to Lloyd's Register of Shipping

ALSO FOR

SPL FOR

TRO

SRL

POSTING

HEADER

CERT

Lloyd's Register
FoundationAt part or complete Special Surveys those items which are not applicable
to the ship are to be cancelled; this need not be done when the machinery is
on a continuous survey basis. When any part has been subjected to pressure
test this should be stated. Engine parts when referred to by numbers should
be counted from forward.considered that re-examination or repairs should
be made before that date a distinguishing mark
must be inserted against the item and the
circumstances and action taken & recommended
described fully under "defects and repairs".The condition of any item is to be described as "good"
only when it has been examined, found or placed in
good condition, and is considered to be acceptable
until the due date of the next Periodical Examina-
tion. Where repairs have been effected or it is

EXAMINATION AND TESTING OF STEAM PIPES (state material)

MAIN
AUXILIARY
(over 3" bore)

Have saturated pipes in cylindrical boiler smoke boxes been tested?

Were selected copper pipes annealed?

ELECTRICAL EQUIPMENT

PROPULSION (State Port—P, or Starboard—S)		AUXILIARY
Total kW or kVA		Total kW or kVA
a Generators		l Generators & governors
b Exciters		
c Air coolers		m Motors
d Motors		
e Air coolers		n Switchboards & fittings
f Control gear cables, etc.		o Circuit breakers
g Insulation resistance		p Cables
h Insulating oil test		q Insulation resistance
i Overspeed governors		r Steering gear generators & motors
j Magnetic couplings		s Navigation light indicators
k Air gap		

PARTICULARS OF DEFECTS, REPAIRS, ALTERATIONS, ETC.

Attended at request of Owners at Messrs. van Wijnsbergen of The Hague.


Electrical:

Starboard F.D. Fan. Electric Motor Armature:-

The following repairs were found to be necessary and have been carried out satisfactorily.

1. Armature completely rewound.
2. New commutator made and fitted.
3. New front Vee ring for commutator made and fitted.
4. New commutator boss made and fitted.

The reason for repairs must be stated and those on account of damage, the alleged cause of which must be given, should be detailed separately from wear and tear repairs. State what action has been taken regarding items which are subjects of class. State also where appropriate, for the information of the Technical Records Dept., the material of the defective item and whether it is a forging, casting or welded fabrication. Any alterations in existing particulars in the Register Book should be reported above.

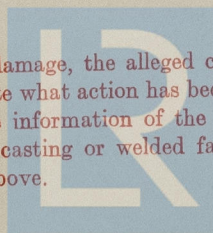

© 2021

Lloyd's Register
Foundation