


COPY

LLOYD'S REGISTER OF SHIPPING

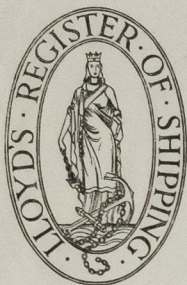

Port Bangkok.

25th May, 1962.

This is to Certify that I have
Surveyed the Machinery of the M.V. "SAIBURI",
of Bangkok.

and that I will transmit to the Committee of Lloyd's Register of
Shipping, London, a Report stating that all recommendations made by
me in connection therewith have been carried out to my satisfaction; also
that I will Recommend that in the case of this Vessel the following
Survey Records be made in the Supplement to the Register Book
Parts seen with date - CS. TSN


and that her Machinery Classification Record be continued in the Book.

Ballast Pump, Starboard, ford. Stand-by Lubricating Oil Pump, Port.
Electric driven air compressor, Port. Scaveng air blower, Engine
driven - all completely dismantled.
Starting Air Vessels - Port, inboard and outboard - internally
Parts now examined: externally, all mountings.
(C.S. Items only) Sea Connections, opened up, ground in refitted.

Main Engine - No. 2 Cylinder, piston rod, cover, valves and gears,
top end pin and bearing, crankpin, bearings & bolts.
Nos. 7 & 8 Main Bearings and journals.
Thrust Blocks, shaft and bearings.
Intermediate shaft and bearings.

Propeller Shaft liner worn - Spare shaft fitted Marks - Lloyd's
No. 771, 6-9-37 T.S.M. CL.

Stern tube bearing - Cutlass Rubber Bearing no wear, spare shaft
fitted with 1/64" clearance.


D.C. Knott,

Engineer Surveyor to Lloyd's Register

KEY TO ABBREVIATIONS

ABS Auxiliary Boiler Survey
CS Continuous Survey of Engines
DBS Donkey Boiler Survey
ES Engine Special Survey
MBS Main Boiler Survey
MES Modified Survey of Oil Engines
OF Fitted for oil fuel (date) FP above 150°F.

SGS Steam Generator Survey
SPS Steampipe Survey
TS Tailshaft Survey
TS(CL) Tailshaft Survey—Continuous Liner
TSN Tailshaft renewed
TS(OG) Tailshaft Survey—Oil Gland

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

(Cert. B.1J 150m,5,60 (MADE AND PRINTED IN ENGLAND))

010537-010544-0180