

Rpt. 13.

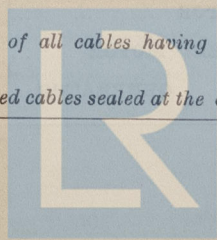
No. 55242

## REPORT ON ELECTRICAL EQUIPMENT.

(OTHER THAN FOR THE PROPULSION OF THE VESSEL)

Received at London Office

13 NOV 1948

Date of writing Report.....19..... When handed in at Local Office.....19..... Port of HULLNo. in Survey held at Hull Date, First Survey 27.9.48 Last Survey 26.10.1948  
Reg. Book. (Number of Visits.....)52369 on the S.S. "BALTRADER" Tons { Gross 1846  
Net 990Built at Hamburg By whom built Deutsche Werft A.G. Yard No. - When built 1945Owners United Baltic Corporation Ltd. Port belonging to LondonElectrical Installation fitted by A.E.G. Contract No. - When fitted 1945Is vessel fitted for carrying Petroleum in bulk No Is vessel equipped with D.F. Yes E.S.D. Yes Gy.C. No Sub.Sig. NoHave plans been submitted and approved No System of Distributions single wire hull return Voltage of supply for Lighting 220Heating 220 Power - Direct or Alternating Current, Lighting D.C. Power D.C. If Alternating Current state periodicity - Prime Movers,has the governing been tested and found as per Rule when full load is suddenly thrown on and off Yes Are turbine emergency governors fitted with atrip switch as per Rule - Generators, are they compound wound Yes, are they level compounded under working conditions Yes,if not compound wound state distance between generators - and from switchboard - Where more than one generator is fitted are theyarranged to run in parallel No, are shunt field regulators provided Yes Is the compound winding connected to the negative or positive polenegative Have machines over 100 kw. been inspected by the Surveyors during manufacture and testing - Have certificates oftest for machines under 100 kw. been supplied No and the results found as per rule Yes Are the lubricating arrangements and the constructionof the generators as per rule Yes Position of Generators Engine room starboard side.-, is the ventilation in way of generators satisfactory Yes are they clear of inflammable material Yes, if situatednear unprotected combustible material state distance from same horizontally - and vertically -, are the generators protected from mechanicalinjury and damage from water, steam and oil Yes, are the bedplates and frames earthed Yes and the prime movers and generators in metalliccontact Yes Switchboards, where are main switchboards placed Engine room starboard side near generator.are they in accessible positions, free from inflammable gases and acid fumes Yes, are they protected from mechanical injury and damage from water, steamand oil Yes, if situated near unprotected combustible material state distance from same horizontally - and vertically -, what insulationmaterial is used for the panels "Sindanyo", if of synthetic insulating material is it an Approved Type Yes, if ofsemi-insulating material (slate or marble) are all conducting parts insulated therefrom as per Rule - Is the frame effectually earthed YesIs the construction as per Rule Yes, including accessibility of parts Yes, absence of fuses on the back of the board Yes, individual fusesto pilot and earth lamps, voltmeters, etc., Yes locking of screws and nuts Yes, labelling of apparatus and fuses Yes, fuses on the "dead"side of switches Yes Description of Main Switchgear for each generator and arrangement of equaliser switches Double pole knifeswitches & double pole fuses.and for each outgoing circuit Single pole knife switches and single pole fuses.Are compartments containing switchboards composed of fire-resisting material or lined as per Rule Yes Instruments on main switchboard twoammeters two voltmeters - synchronising devices. For compound machines in parallel is the ammeter connected on the pole opposite to theequaliser connection - Earth Testing, state means provided Not fitted, earth return system.Switches, Circuit Breakers and Fuses, are they as per Rule Yes, are the fuses an approved type Yes, are all fuses labelled asper Rule Yes If circuit breakers are provided for the generators, at what overload current did they open when tested -, are the reversed currentprotection devices connected on the pole opposite to the equaliser connection -, have they been tested under working conditions, and at what currentdid they operate - Joint Boxes, Section Boards and Distribution Boards, is the construction and position as per Rule YesCables, are they insulated and protected as per the appropriate Tables of the Rules Yes, if otherwise than as per Rule are they of an approved type -,state maximum fall of pressure between bus bars and any point under maximum load 4V, are the ends of all cables having a sectional area of 0.04square inch and above provided with soldering sockets Yes Are paper insulated and varnished cambric insulated cables sealed at the ends -

© 2021

Lloyd's Register  
Foundation

010805-010815-0257 1/2



The Electrical Equipment is installed in accordance with the approved plans and the requirements of the Rules.  
All Insulated Conductors are guaranteed to have been tested at the maker's works as specified in the Rules.  
The foregoing is a correct description.

Electrical Engineers.

Date

COMPASSES.

Minimum distance between electric generators or motors and standard compass 70'0"

Minimum distance between electric generators or motors and steering compass 72'0"

The nearest cables to the compasses are as follows:—

A cable carrying 2 Ampères inside feet from standard compass 14'0" feet from steering compass.

A cable carrying 2 Ampères 14' feet from standard compass inside feet from steering compass.

A cable carrying — Ampères — feet from standard compass — feet from steering compass.

Have the compasses been adjusted with and without the electric installation at work at full power Yes

Has the effect of switching on and off circuits, motors and other electro-magnetic apparatus within the vicinity of the compasses been noted Yes

The maximum deviation due to electric currents was found to be Nil degrees on every course in the case of the standard compass, and Nil degrees on every course in the case of the steering compass.

Builder's Signature.

Date

Is this installation a duplicate of a previous case Yes

If so, state name of vessel

similar to "BALTONIA".

Plans. Are approved plans forwarded herewith No

If not, state date of approval

Certificates. Are certificates of test for motors engaged on essential services and generators forwarded herewith

General Remarks (State quality of workmanship, whether insulation tests, etc., have been made, opinions as to class, etc.)

The electrical installation as now seen appears, with minor alterations carried out in this country, to have been installed in Germany by the A.E.G. and in accordance with German practice.

The generators have been changed and two 15 K.W. (Makers Cambell & Isherwood) and new main switchboard fitted.

The generators, steering gear, lighting circuits etc. were tested under working conditions with satisfactory results and the insulation resistance of all circuits and apparatus measured and found good.

The installation appears to be in efficient condition and whilst not strictly in accordance with the Society's Rules, is, in my opinion, eligible to be accepted for classification.

Noted Sub 22/12/68

Total Capacity of Generators 30 Kilowatts.

The amount of Fee £ 10 : -

When applied for, 11 NOV 1948

19

Travelling Expenses (if any) £ : :

When received.

19

W. H. Cornwell

Surveyor to Lloyd's Register of Shipping.

Committee's Minute

TUE. 9 AUG 1948

Assigned

See minute on file  
mady rpl



© 2021

Lloyd's Register  
Foundation