

LLOYD'S REGISTER OF SHIPPING

ALTERATIONS TO CONDITIONS OF ASSIGNMENT OF LOADLINES


Ship's Name S/S "LOBITO" ex "RIO YAPE" Official No. -

Port of Registry Panama

This ship has been under survey at La Spezia

~~on~~ in March - May ⁶⁰ 19~~5~~ and the following alterations to the conditions of assignment of loadlines have now been effected^{or}/found:—

NOW EFFECTED:- Existing No.3 hatchway on boat deck extended aft to include adjacent coaling hatchway by removing existing trunking bulkhead No.86 but maintaining trunking bulkhead at frame 83. No.3 hatchway on shelter deck similarly extended aft, the above trunked hatchway resulting now 6920 mms long. ^{The} ~~Each~~ hatchway is now fitted with 4 hatch beams, a new hatch beam having been provided at frame No. 86 as follows:

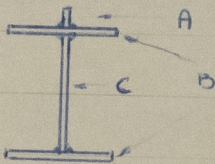

A = 60 x 10 mms

B = 160 x 15 mms

C = 510 (at center) x 10 mms

The above alteration was carried in accordance with approved plans.

- The existing coaling hatch openings on shelter deck (2 port and 2 stbd) now permanently closed by 10 mms plate suitably stiffened. The casing in 'tween decks in way dispensed with. The existing hatchway coamings were maintained with their closing appliances to be used as galley coal stores.
- The midship vegetable oil deep tank (p. & s.) was now converted to O.F. storage tank to be always completely full or empty. Therefore, each 18" hatch coaming was satisfactorily plated over and provided with 25" x 21.5" man hole closed oil tight by bolted steel cover. Also the existing vents (2 port and 2 stbd) to deep tanks dispensed with and shelter deck & freeboard deck plating in way plated over.
- Each deep tank (p. & s.) is now provided with air pipe 210 mms dia. 910 mms above shelter deck, fitted with double wire gouze and shlf closing steel cover.

FOUND:- Casing in 'tween decks between Nos. 2 & 3 hatches and hatch opening on fbd. dk. in way previously dispensed with.

- Coaling hatchways on freeboard deck (2 port & 3 stbd) previously dispensed with

Noted
Full
8-7-60

P. Cesari

(P. Cesari)
SURVEYOR TO LLOYD'S REGISTER OF SHIPPING

A copy of this Report has been placed on board.

5m,6,50. T.



© 2021

Lloyd's Register
Foundation

010835-010845-0117