

London 10/10/32

Index No. **29406**  
(For London Office only.)

# Lloyd's Register of Shipping.

## SURVEYS FOR FREEBOARD.—STEAM SHIPS.

Particulars relating to all steam ships either flush decked, or with gallant forecastles, short poops and bridge houses disconnected, or with top gallant forecastles having long poops, or raised quarter decks connected with bridge houses, or otherwise.

Port of Survey Gothenburg  
Date of Survey Sept 10. 1920  
Name of Surveyor J. H. Kantr

RID THORDEN

Ship's Name.	Port of Registry and Nationality.	Official Number.	Gross Tonnage.	Date of Build.	Particulars of Classification.
<u>VÄPPINGSBORG</u> <u>ALMEN No 445</u> Number in Register Book	<u>NORRHÖPING</u> <u>SWEDISH</u>		<u>1885</u>	<u>1920</u>	<u>100 A 1</u> <u>Class contemplated.</u>

Length.	Breadth.	Depth.	Under Deck Tonnage.
<u>262.01'</u>	<u>42.70'</u>	<u>18.11'</u>	<u>1621</u>
Frame Depth	8	Ceiling fitted	Peak
Rule	" 5	Sheer <u>4.53</u>	Tanks
	" 3	Depth to	
	" 5	Inner Bottom	
		<u>18.33</u>	
<u>264.29</u>	<u>42.30</u>	<u>18.86</u>	<u>1621</u>

Efficiency of fineness..... .77  
Modification necessary }  
Para. 4 (a) to (e)]\* } C.D.B.  
Efficiency as corrected ..... .75

Stem..... 77.5"  
Sternpost..... 33.5"  
 $111" \div 2 = 55.5"$  Mean 19.07 .53  
Stem 42.5"  
Sternpost 18.5"  
 $61" \div 2 = 30.5"$  Mean  
Dual mean Sheer ..... 55.5  $\div .55 = 55.5$   
Standard mean Sheer [Table, Para. 18] ..... 36.43 Correction  
Difference..... 19.07  $\div 4 = -4\frac{3}{4}$   
If limited as Para. 18 (f) .....

At front of bridge house..... 25"  
At amidships.....  
At after end of forecastle..... 50.5"  
Measured relative to straight line of keel  
Fall in Sheer }  
Para. 18 (d) } 50"  $\div 2 = .25"$   
Length uncovered ..... Correction ✓

ALLOWANCE FOR DECK ERECTIONS:—  
Freeboard, Table C..... 1' 5 1/4"  
Correction for Length, if required (Para. 12, 13, and 14) .....  
Freeboard by Table A. corrected for sheer, and for length, if required (Para. 12, 13, and 14) } 3' 7"  
Difference ..... 2' 1 3/4"  
Percentage as below..... 57%  
14 1/2"

Correction for R. Q. Dk. if engine and boiler openings not covered by bridge house (Para. 11) }  
Allowance for Deck Erections ..... 14 1/2"  
Length. Length allowed. Height.  
Forecastle..... 26' 0" 26.0 7' 0"  
Bridge House..... 154' 9" 153.2 7' 0"  
Including 1 1/2' overhang each end  
Raised Qr. Dk.....  
23' 6" 23.5 7' 0"  
Total ..... 202.4  $= .77$   
Length of Ship ..... 264.29  
Responding percentage {  
Para. 11, 12, 13, and 14 } 57%

Freeboard recommended amidships from centre of Disc to top of Statutory Deck Line, Wood (Iron) Deck:—  
Fresh Water Line .....  
Indian Summer Line .....  
Winter Line ..... below .....  
Winter North Atlantic Line ..... below .....  
19.10.2

the frames, skin planking, or ceiling are of unusual thickness the breadth of vessel to inside of ceiling should be reported if possible.  
In vessels obtaining an allowance for deck erections under Para. 11 where the sheer drops abaft amidships the height of the R.Q.D. is to be taken from the level of the top of the amidship beam.  
In vessels having poops and forecastles, it means the sheer measured at the stem and stern-post, and the vessel's length from stem and stern-post.

Moulded Depth as measured..... 20' 6"  
Measured from top of keel to tanktop  
from tanktop to top of beams at side.  
Addition for Keel below base line  
for draught record..... 14 inches.

NOTE.—If the depth is measured when vessel is afloat, the details of measurement should be reported.

CORRECTION FOR LENGTH.  
Length of Ship on Loadline..... 264.29  
Length in Table ..... 246.0  
Difference ..... 18.29  
Correction for 10ft., Table A. .... 1.2 Table C.  
 $\times$  Difference divided by 10 ..... 2.19 (if required.)  
If  $\frac{1}{10}$ ths length covered divide by 2 1.09  
+ 1"

CORRECTION FOR IRON DECK.  
Proportion covered, if less than  $\frac{1}{10}$ ths length covered .....  
Thickness of usual wood deck, less stringer ..... - 3 1/2"

CORRECTION FOR ROUND OF BEAM.  
Breadth at Gunwale amidships..... 42  
Round of Beam..... 10 1/2"  
Normal round..... 10 1/2"  
Difference .....  $\checkmark \div 2 =$  .....  
Proportion of Deck uncovered (Para. 19) .....

NOTE.—The round of beam should be reported on the full breadth of vessel at the gunwale.

Freeboard, Table A ..... 3' 11 3/4"  
Correction for Sheer ..... - 4 3/4"  
Correction for Length ..... 3' 7"  
Allowance for Deck Erections ..... 1' 5 1/4"  
Correction for Round of Beam..... ✓  
Correction for fall in Sheer (if any).....  
Correction for Iron Deck (if required) ..... - 3 1/2"  
Additions for non-compliance with provisions of }  
Para. 11 (d) and (e) } 2' 2"  
Other Corrections (if any) .....

Winter Freeboard ..... 2' 2"  
Summer Freeboard ..... 3 1/4" 1' 10 3/4"  
Indian Summer Freeboard ..... 1' 4 1/2"  
N. A. Winter Freeboard ..... 2' 4"  
Correction necessary because clearside amidships, measured in accordance with the Statute is not taken at the intersection of the wood or iron deck with side. 1 3/4"

Winter Freeboard from deck line ..... 2' 3 3/4"  
Summer " " " ..... 2' 0 1/2"  
Indian Summer " " " ..... 1' 9 1/4"  
N. A. Winter " " " ..... 2' 5 3/4"  
2' 0 1/2"  
4 1/2"  
3 1/2"  
3  
5

State dimensions of freeing port area on back of this form.  
The Surveyor should state whether the fall in sheer as reported is measured relatively to the straight line of keel or to the water line. If measured relatively to water line the vessel's draft at time of survey, and also the usual load draft forward and aft should be reported.

010835-010845-0234  
MARKING REPORT  
RECEIVED 11.10.30



Do all the Frames extend to the top height in the Poop? *No* Raised Quarter Deck? *Yes* Bridge House? *Alternately* Forecastle? *Yes*  
 To what height do the Reverse Frames extend? *Bulk's angle framing*  
 Has the Poop or Raised Quarter Deck an efficient Iron Bulkhead at the fore end? *Yes*  
 Give particulars of the means for closing the openings in Bulkhead *No openings*  
 Is the Poop or Raised Quarter Deck connected with the Bridge House? *No* Has the Bridge House an efficient Bulkhead at the fore end? *Yes*  
 Give particulars of the means for closing the openings in Bulkhead *2 efficient watertight hinged doors, properly packed*  
 What is the thickness of the Bridge Front plating? *.36"* and Coaming plate? *No coaming plate*  
 Give scantlings and spacing of the Stiffeners *L 8x3x.50 spaced 30"*  
 Are bracket plates fitted at each end of the Stiffeners? *Yes* Are hor'l. brackets fitted connecting Bridge Bulk'd. with Bulwarks? *No*  
 Has the Bridge House an efficient Iron Bulkhead at the after end? *Yes*  
 How are the openings closed *by weatherboards in built channels 3'-9" high*  
 Is the Forecastle at least as high as the main or top-gallant rail? *Yes* Has the Forecastle an efficient Iron or Wood Bulk'd. at after end? *Yes*  
 Are the Engine and Boiler openings covered by a Bridge, Poop, Raised Quarter Deck, or enclosed by a Strong Iron or Steel Deckhouse? *Covered by the Bridge*  
 If the openings are not so protected are the exposed parts of the Casings efficiently constructed? *Yes*  
 Give thickness of plating; scantlings and spacing of Stiffeners  
 What is the height of the exposed Casings? *Yes* Are suitable means provided for closing all openings in them in bad weather? *Yes*  
 Are the Weather Deck Hatchways efficiently constructed and at least equal to the requirements of Section 28 of the Rules for 1904-5? Give particulars below:— *Yes*

Position and Size.	#1:- 25'-6" x 18'-0"		#2:- 25'-6" x 18'-0"		#3:- 25'-6" x 18'-0"		#4:- 25'-6" x 18'-0"			
Item.	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.
COAMING.	Height above top of DECK	32"	32"		32"		32"			
	Thickness { Sides.....	.46"	.46"		.46"		.46"			
	Ends.....	.44"	.44"		.44"		.44"			
SHIFTING BEAMS OR WEB PLATES.	Number.....	4x3x.44	4x3x.44		4x3x.44		4x3x.44			
	Section and Scantlings.....	16x.36	12x.32		12x.32		16x.36			
	Material.....	Steel	Steel		Steel		Steel			
* FORE AND AFTERS.	Number.....	None	None		None		None			
	Section and Scantlings.....									
	Material.....									
HATCHES Thickness		3"	2 1/2"		2 1/2"		3"			
Remarks.....										

\* The depth of Fore and Afters should be stated from the underside of the hatches in all cases.  
 (If the sill of the lowest side scuttle will be less than 6 inches above the Indian Summer Load Line if assigned under the tables, state vertical distance from top of deck at side amidships to lower edge of lowest side scuttle.)

The following information is to be given in all Cases of vessels dealt with under Paras. 11, 12 (under 15 feet Moulded depth) and under Shelter Deck Rules.  
 What is the thickness of the Bridge Sheerstrake? *.52"* Strake between Main and Bridge Sheerstrakes? *Yes*


Delete the words } The Crew ~~are~~ are not, berthed in the bridge house.  
 that do not apply } The arrangements to enable them to get backwards and forwards from their quarters are, are not satisfactory.

Length of Bulwarks in well *Forward 29'-4", Aft 29'-4"*

Area of Freeing Ports required by Para. 11 (e) each side of vessel = Sq. ft.

Ft.	Tenths.	Ft.	Tenths.	No.	Freeing Ports (each side of vessel)	= 24	Sq. ft.
3.0	x	2.0	x	2			
3.0	x	2.0	x	2			

Total deficiency or excess = Sq. ft.

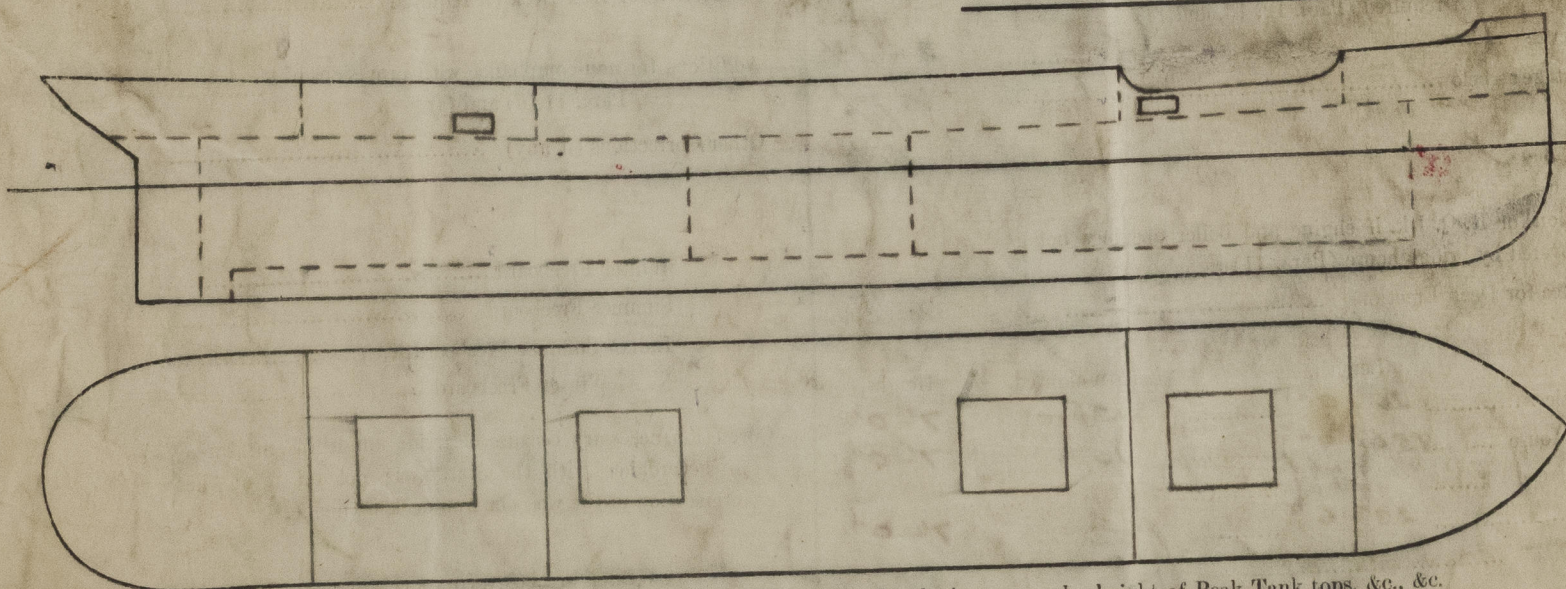

Show hereon line of Floors or Tank Top with position of any Breaks in same; also height of Peak Tank tops, &c., &c.

State any special features in the construction of the Vessel

*This vessel is a Sister Ship of "BRÄVALLA", built by the same firm.*

Owners *H. UNÉR AKTIEBOLAG*

" Address *NORRHÖPING*

Fee *£ 14. 57. 30.*

Received by me



© 2021

Lloyd's Register  
Foundation