

EA

COPY

Ship's name "HINAMAK"

Port

BMN

No. 7380

Class is subject to

Last survey date 15.9.64.

NONE

S.R.L. Appendix (as before or none)

Surveys due

SPECIAL SURVEY (C) due 9,65.

Nature of present survey (afloat and in drydock)

Locking: Commencement of S.S.  
Contact damage and wear and tear repairs.

Is interim certificate in order

Yes/No/None

Items outstanding if any for SS

FOR PORTION OF SURVEY HELD:- See List in Ship Reports Dept.

SS proposed to be completed by

Recommendation

SUBMITTED record of DS 9,64 be assigned, subject to wasted F.P. tank structure, tank top of (p & s) forward deep tanks, coaming of access hatch to aft cofferdam (p.s), structure in way of E.R. aft well and indented shell plates H.9 & 11, J.9 & 11 (p.s. from fwd) being specially examined and dealt with as necessary by the Special Survey.

DS 9,64 Subject

IN S.R.L. APPENDIX


Keel plate No.2 forward slightly set up.  
(Shell and deck plating to be drilled tested 9,65)  
(Lengthened and amids portion renewed 9,57).

SHIP DEVELOPMENT TO NOTE

As the defects reported do not require to be dealt with until the SS. JKS submitted a resolution of Class withdrawn at Owners request be assigned. 1/10/64

25/12/11/64

End. S.2

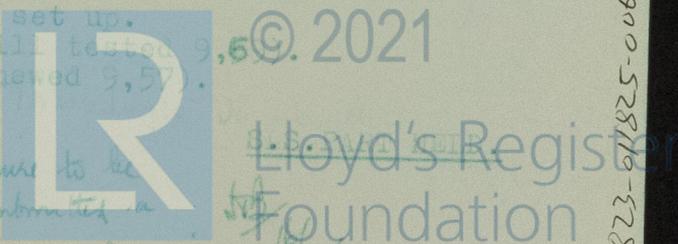

011823-9/1825-0060